

General Information

Date & Time: 27, Jul, 2026 15:01

Make	Honda	Model	Civic
YOM	2017	Odo Meter Reading	61,246
Registration No.	NBI9566	Chassis No.	MRHFC6630HT021469
CC	1.8	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Blackish Red Mica		

Body / Panel Condition



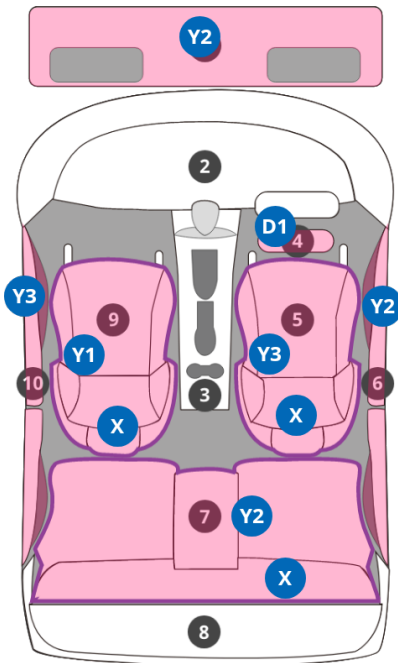
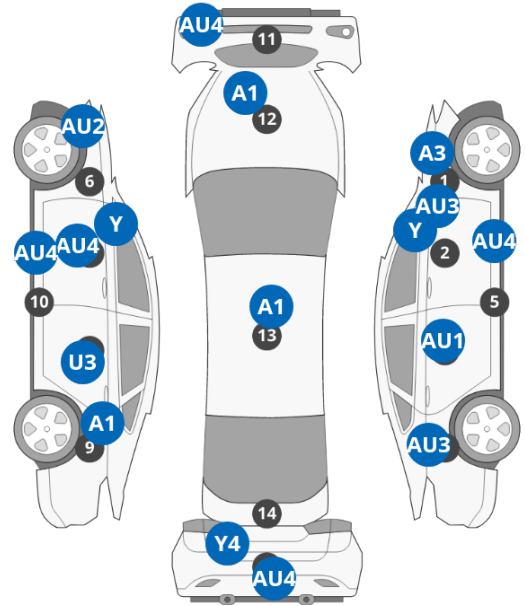
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	127.3	127	121	134
2	Boot Lid	148.0	145	149	150
3	Roof	278.2	175	178	615/145
4	Left Front Fender	115.6	125	112	110
5	Left Front Door	121.3	121	120	123
6	Center Panel Left				
7	Left Rear Door	120.6	115	121	126
8	Left Back Panel	111.6	112	108	115
9	Right Front Fender	117.6	116	119	118
10	Right Front Door	122.6	122	121	125
11	Center Panel Right				
12	Right Rear Door	188.6	180	204	182
13	Right Back Panel	325.0	192	239	544

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / (R) Front Seat Head Rest - Missing - Yes / (L) Front Seat Head Rest - Missing - Yes / Rear Seat Head Rest - Missing - Yes / Rear Seat - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Medium / Carpet - Worked - Minimal / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Minimal	Remarks (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Medium / (R) Mirror - Crack - Damaged / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Crack, Gap - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Dent - Medium / (L) Front Door, Molding - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (L) Mirror - Crack - Damaged / (L) Front Fender, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : C	Functional Evaluation : C
Remarks Center Floor Panel - Bulge (Cuts, Major Deforms) or Corrosion ? - Yes / Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Warning Lamps - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
With Lto plate, with warranty booklet and jack, 1key,no spare tire and tools, possible flooding, warning lamp on