

General Information

Date & Time: 27, Jul, 2026 09:58

Make	Nissan	Model	NV350
YOM	2019	Odo Meter Reading	114,115
Registration No.	BAB8122	Chassis No.	JNTUC4E26Z0025254
CC	2.5	Transmission	A/T
Fuel Type	Diesel	Type of Body	Van
Colour	Gray		

Body / Panel Condition



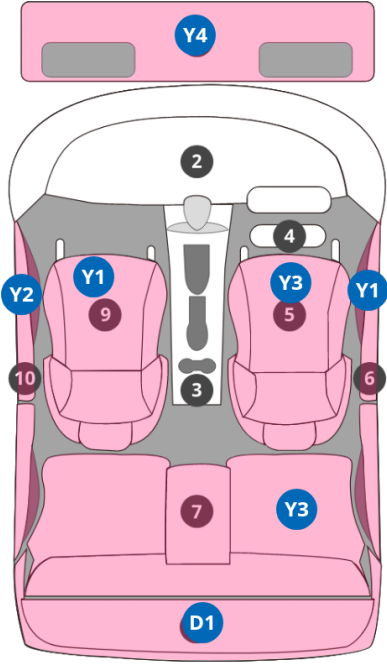
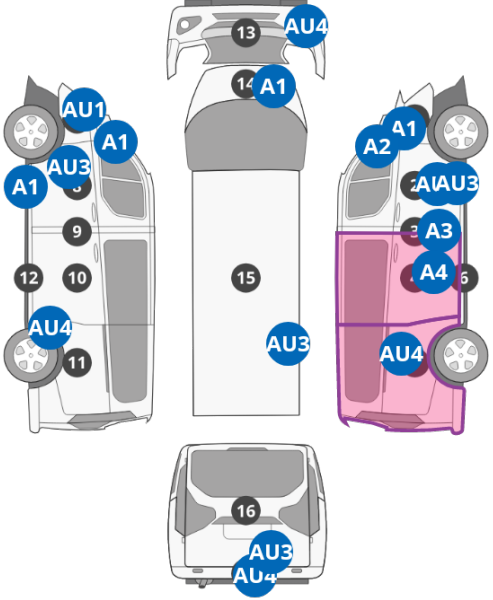
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	96.6	98	98	94
2	Boot Lid	96.4	98	102	89
3	Roof	102.6	91	87	120/112
4	Left Front Fender	83.3	80	97	73
5	Left Front Door	87.6	80	87	97
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	95.0	98	90	97
9	Right Front Fender	80.2	76	77	88
10	Right Front Door	130.3	120	125	146
11	Center Panel Right	118.3	129	101	125
12	Right Rear Door	184.0	227	162	163
13	Right Back Panel	290.4	97	115	659

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Grime - Minimal / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Minimal / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / Trunk Room - Loose, Deformed - Minimal / Ceiling - Grime - Large / Overall Interior - Worn as per age - Yes	Remarks (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Center Panel - Scratch - Medium / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Scratch & Dent - Large / Roof - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Front Panel - Scratch - Minimal / (L) Front Fender, Molding - Scratch & Dent - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
With Lto plate ,with spare tire and jack, 2keys, no warranty booklet and tools, scratches on headlights and taillights, rear seat issue,Worn tires, bumper logo issue