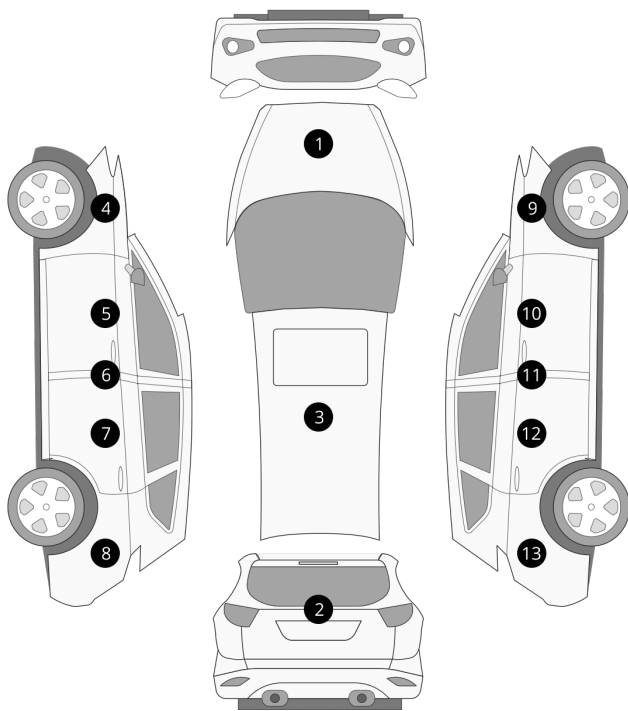


General Information

Date & Time: 25, Jul, 2026 16:01

Make	Suzuki	Model	Jimny
YOM	2022	Odo Meter Reading	35,509
Registration No.	IAE2460	Chassis No.	MA3JB74V3P0116314
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	Wagon
Colour	White		

Body / Panel Condition



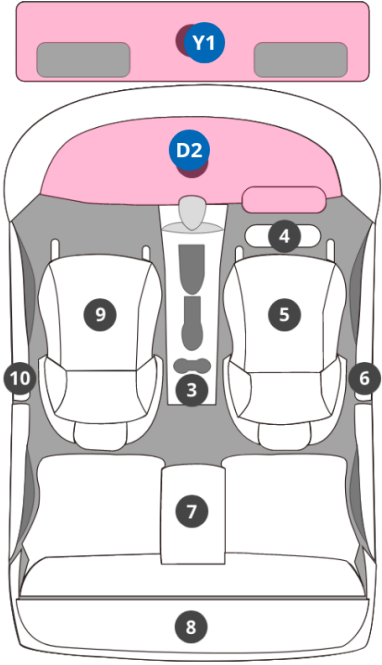
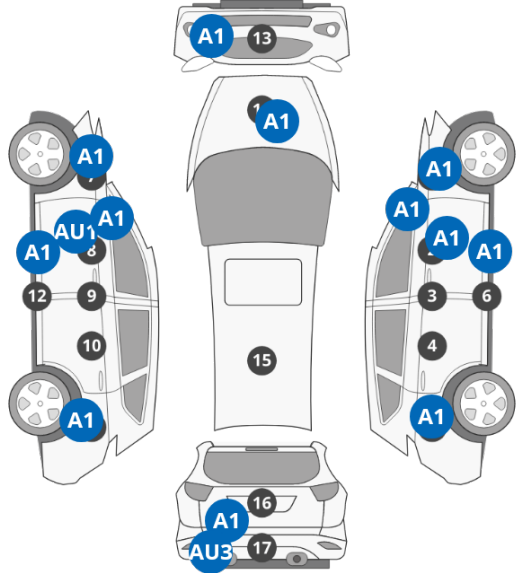
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	101.8	106	104	95
2	Boot Lid	101.8	84	113	108
3	Roof	102.3	110	98	93/108
4	Left Front Fender	92.9	85	99	95
5	Left Front Door	87.3	90	96	77
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	100.9	103	88	112
9	Right Front Fender	96.0	99	98	92
10	Right Front Door	104.0	99	107	106
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	109.0	110	99	118

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Minimal / Dashboard - Loose, Deformed - Small	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

No Rear Lto plate, with spare tire 1key, no warranty booklet and tools and Jack,