

General Information

Date & Time: 30, Jul, 2026 10:35

Make	Nissan	Model	NV350
YOM	2018	Odo Meter Reading	111,328
Registration No.	NCS9250	Chassis No.	JN1TC2E26Z0063056
CC	2.5	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	White		

Body / Panel Condition



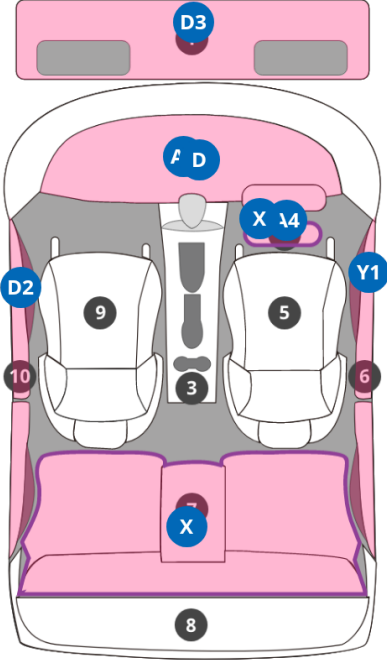
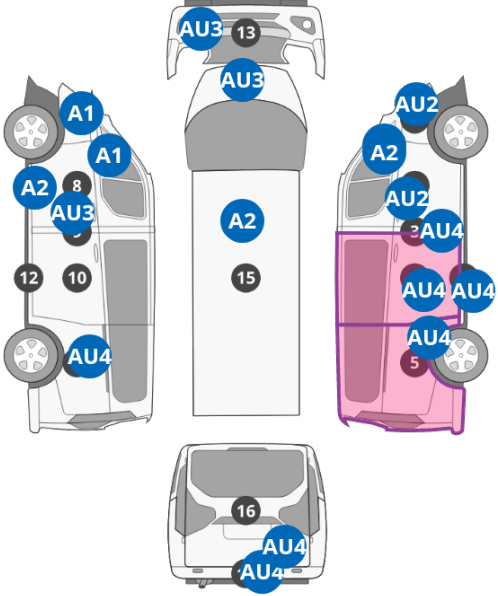
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	302.3	111	691	105
2	Boot Lid	101.8	98	99	109
3	Roof	100.3	83	162	77/79
4	Left Front Fender	87.0	91	87	83
5	Left Front Door	87.8	97	80	87
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	114.0	88	112	142
9	Right Front Fender	90.7	92	95	86
10	Right Front Door	268.3	142	537	126
11	Center Panel Right	124.3	101	152	120
12	Right Rear Door	490.6	978	162	332
13	Right Back Panel	338.6	117	133	766

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Partially Missing - Yes / Carpet - Worn, Scratch, Cut, Crack - Large / (L) Front Floor Mat - Missing - Yes / (R) Front Trim - Grime - Minimal / Ceiling - Loose, Deformed - Medium / (L) Front Trim - Worked - Small / Steering Wheel - Worn, Peel, Crack - Large / Dashboard - Traces of Adhesive Tape - Yes / Overall Interior - Worn as per age - Yes	Remarks (R) Front Door - Repair Traces - Yes / Front Panel - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Center Panel - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Mirror - Crack - Cracks / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Center Panel - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Door, Molding - Repair mark - Difference in Color / (R) Rear Fender, Molding - Repair mark - Difference in Color / (R) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Panel - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Small / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : E
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes / Panel, Meter - Issue - Yes / Air Conditioner - Function - Weak / Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Turn Signal, Hazard Flasher - Issue - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
With Lto plate, with spare tire, 1key, no warranty booklet and tools and Jack, scratches on headlights and taillights, non moving vehicle,instrument panel issue,turn signal issue,radio issue ,aircon issue,