

General Information

Date & Time: 28, Jul, 2026 12:28

Make	Toyota	Model	Lite Ace
YOM	2024	Odo Meter Reading	58,710
Registration No.	FAR3811	Chassis No.	MHKU3FE10PK006042
CC	1.5	Transmission	M/T
Fuel Type	Gas	Type of Body	Dropside
Colour	White		

Body / Panel Condition



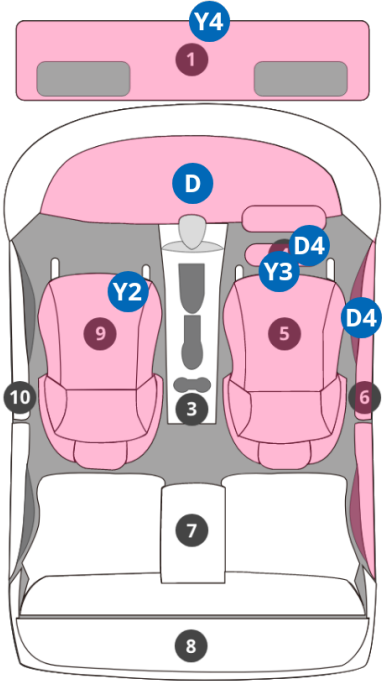
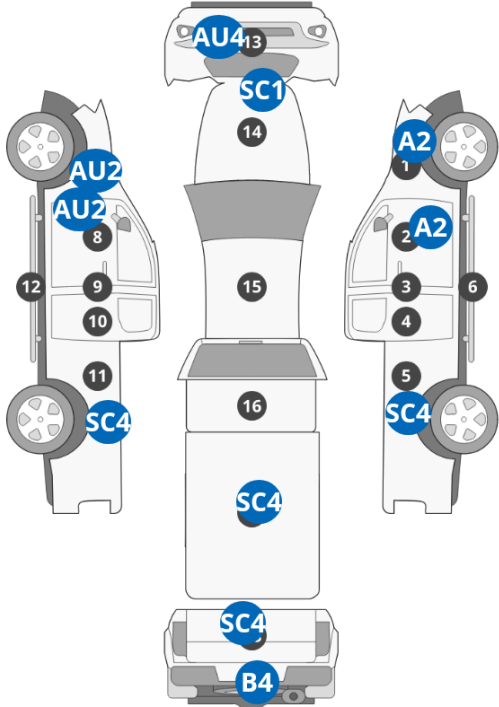
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	56.6	69	47	53
2	Boot Lid	210.3	190	237	204
3	Roof	42.3	41	45	40/43
4	Left Front Fender	42.1	43	44	41
5	Left Front Door	44.7	42	51	41
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	115.3	138	106	102
9	Right Front Fender	48.9	53	47	47
10	Right Front Door	45.8	40	51	48
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	104.8	112	92	111

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Large / Carpet - Worked - Large / Dashboard - Traces of Adhesive Tape - Yes / (R) Front Trim - Worked - Large / (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Small / Overall Interior - Worn as per age - Yes	Remarks (L) Rear Corner Panel - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Side Gate - Rust, Corrosion - Large / Rear Gate - Rust, Corrosion - Large / Rear Bumper, Lamps, Panels - Modified - Large / (L) Side Gate - Rust, Corrosion - Large / Cargo Bed Floor - Rust, Corrosion - Large / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Small / Front Panel - Rust, Corrosion - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

with Ito plates, no warranty booklet, with spare tire, no jack, no tools, modified rear step pad