

General Information

Date & Time: 28, Jul, 2026 17:46

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	36,266
Registration No.	FAT3539	Chassis No.	PA1B18F38S4286668
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



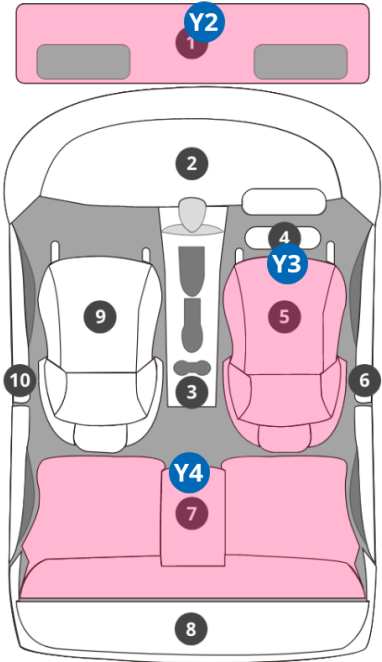
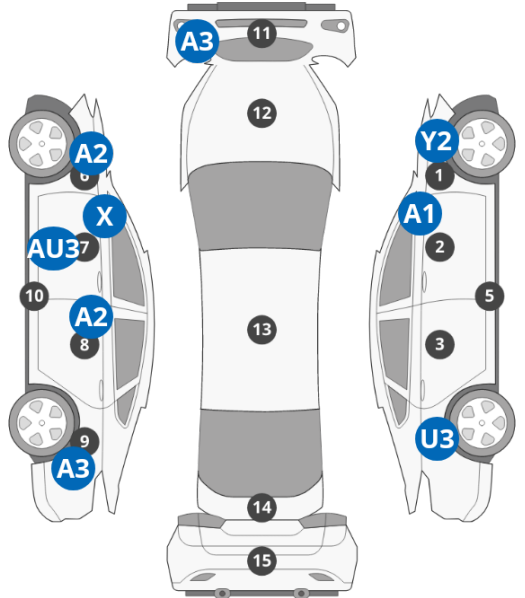
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	100.0	107	99	94
2	Boot Lid	113.6	116	105	120
3	Roof	89.4	94	88	85/91
4	Left Front Fender	88.6	89	88	89
5	Left Front Door	96.1	93	95	101
6	Center Panel Left				
7	Left Rear Door	97.3	103	98	91
8	Left Back Panel	100.8	105	99	98
9	Right Front Fender	81.7	82	81	82
10	Right Front Door	86.6	88	87	85
11	Center Panel Right				
12	Right Rear Door	91.1	84	92	97
13	Right Back Panel	87.9	90	86	88

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Medium / Ceiling - Grime - Small / Rear Seat - Grime - Large	Remarks (R) Front Fender, Molding - Crack, Gap - Small / (R) Mirror - Scratch, Peeled - Minimal / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Rear Fender, Molding - Dent - Medium / (L) Mirror - Stuck - Yes
Frame Evaluation : A	Functional Evaluation : E
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Panel, Meter - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Door Lock - Issue - Yes / Sun Roof - Stuck, Gap - Yes / Power Seat - Issue - Yes / Power Steering - Issue - Yes / Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Power Steering Pump - Leak - Yes / Radiator Water Pump - Leak - Yes / Battery - Weak - Yes / Remote Key & Smart entry - Issue - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Parking Brake - Function - Weak / Brake Pedal - Function - Weak / Turn Signal, Hazard Flasher - Issue - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Horn - Issue - Yes / Seat Belts - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

with Ito plates, no warranty booklet, with spare tire, jack and tools, with hairline scratches in the body, starter issue, left side mirror issue