

General Information

Date & Time: 03, Mar, 2025 12:18

Make	Toyota	Model	Vios
YOM	2024	Mileage	11,904
Registration No.	NKD3761	Chassis No.	PA1B18F34R4259123
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



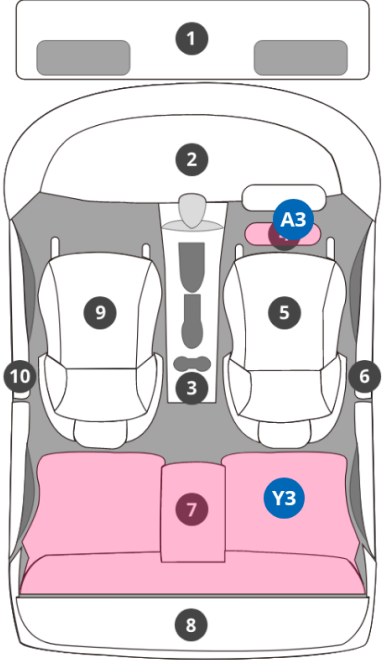
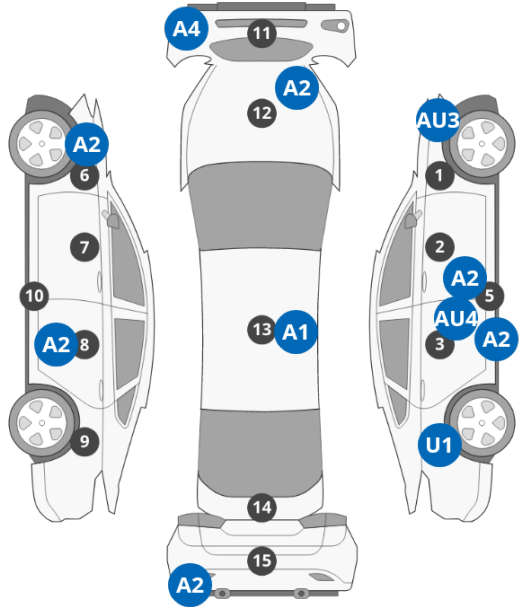
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	166.3	168	163	168
2	Boot Lid	147.3	155	137	150
3	Roof	154.2	195	152	140/130
4	Left Front Fender	158.6	159	155	162
5	Left Front Door	146.3	157	137	145
6	Center Panel Left				
7	Left Rear Door	147.6	166	146	131
8	Left Back Panel	149.6	154	152	143
9	Right Front Fender	155.6	163	146	158
10	Right Front Door	110.6	114	107	111
11	Center Panel Right				
12	Right Rear Door	125.0	124	122	129
13	Right Back Panel	125.6	118	119	140

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Medium / (L) Front Floor Mat - Cut, Crack - Medium	Remarks (R) Rear Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Large / (L) Front Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Dent - Minimal / Roof Spoiler, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / (L) Rear Door, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
with spare tire/with jack /with warranty booklet/ one LTO plate number/without tools