

General Information

Date & Time: 28, Jul, 2026 15:11

Make	Suzuki	Model	Dzire
YOM	2024	Odo Meter Reading	73,699
Registration No.	KAR9502	Chassis No.	MBHZF63S4RG476420
CC	1.2	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Gray		

Body / Panel Condition



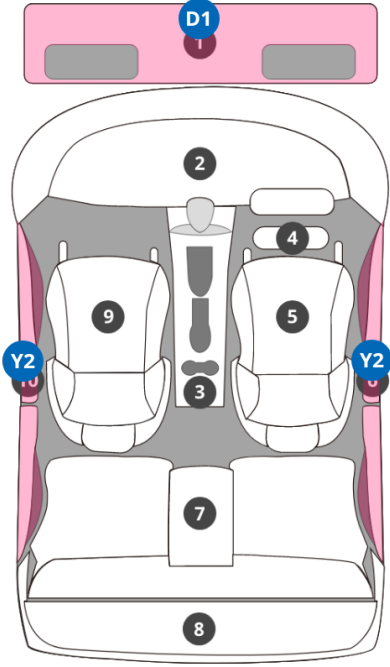
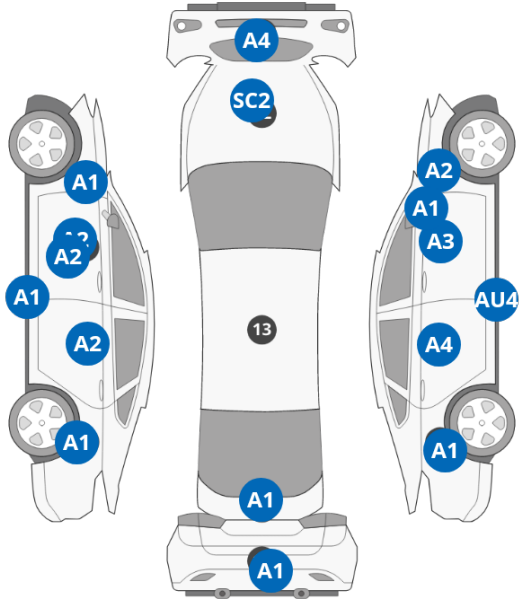
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.0	112	114	104
2	Boot Lid	91.0	93	88	92
3	Roof	115.2	107	103	127/124
4	Left Front Fender	113.0	113	120	106
5	Left Front Door	110.6	114	111	107
6	Center Panel Left				
7	Left Rear Door	107.6	114	107	102
8	Left Back Panel	113.0	109	115	115
9	Right Front Fender	122.3	122	123	122
10	Right Front Door	115.6	113	115	119
11	Center Panel Right				
12	Right Rear Door	109.3	108	106	114
13	Right Back Panel	113.0	113	114	112

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Ceiling - Crinkle - Minimal	Remarks (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Medium / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Rust, Corrosion - Small / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

With LTO plate, with warranty booklet, with tools, with jack, with seat cover, with spare tire, no spare key, with warning device, with hairline scratches, no reverse camera.