

General Information

Date & Time: 31, Jul, 2026 03:47

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	82,498
Registration No.	FAJ5997	Chassis No.	PA1B18F34N4180903
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



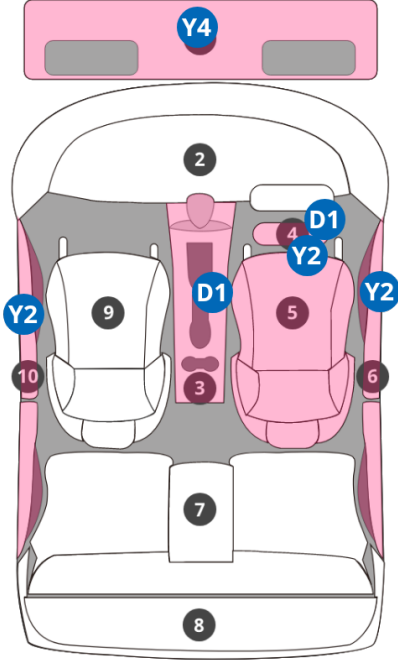
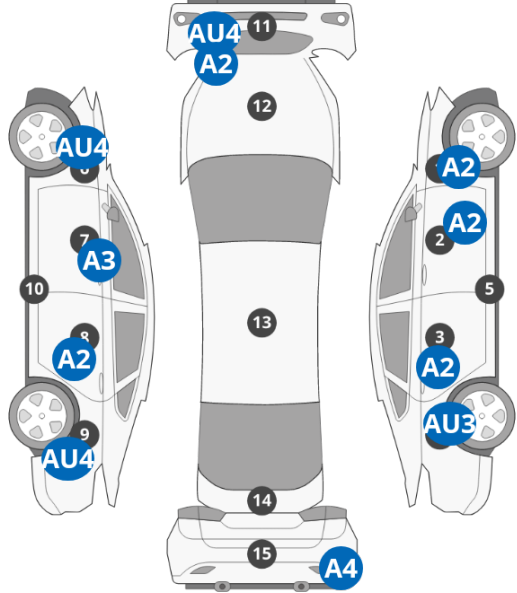
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	85.3	86	82	88
2	Boot Lid	101.7	104	99	102
3	Roof	78.8	84	76	77/79
4	Left Front Fender	87.7	91	86	87
5	Left Front Door	93.5	102	91	87
6	Center Panel Left				
7	Left Rear Door	94.3	99	96	89
8	Left Back Panel	98.5	103	100	93
9	Right Front Fender	72.5	76	62	79
10	Right Front Door	93.4	90	97	94
11	Center Panel Right				
12	Right Rear Door	93.1	93	90	97
13	Right Back Panel	93.3	90	91	100

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Large / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Console, Switchs, Vents - Worked - Minimal / (R) Front Seat - Grime - Small / Carpet - Worked - Minimal	Remarks (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Large / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Small / (L) Front Door, Molding - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with Ito plates, no warranty booklet, with spate tire, with jack, inc tools, hairline scratches in the body,