

General Information

Date & Time: 31, Jul, 2026 15:37

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	51,151
Registration No.	FAO8459	Chassis No.	PA1B18F32P4218700
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



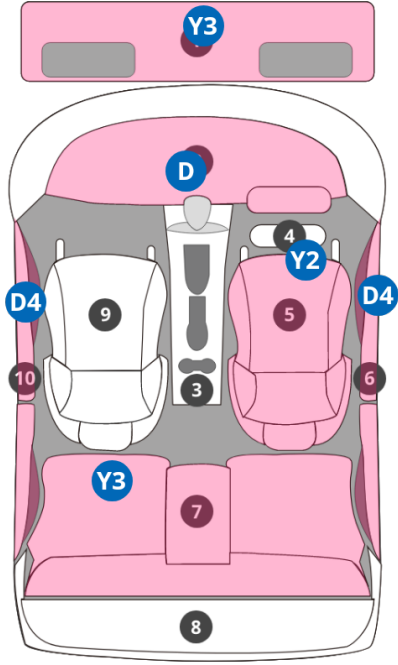
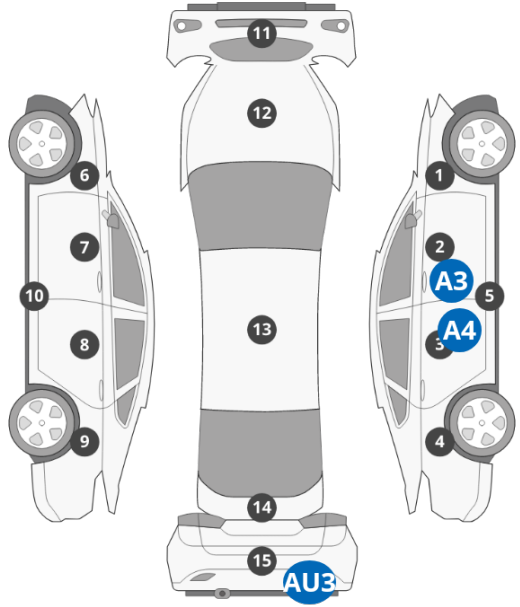
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	100.6	109	100	93
2	Boot Lid	104.0	100	101	111
3	Roof	82.7	89	80	84/78
4	Left Front Fender	85.4	84	83	89
5	Left Front Door	92.4	97	93	87
6	Center Panel Left				
7	Left Rear Door	96.2	95	100	94
8	Left Back Panel	95.3	96	94	97
9	Right Front Fender	136.0	137	134	137
10	Right Front Door	88.0	92	85	87
11	Center Panel Right				
12	Right Rear Door	95.7	97	90	101
13	Right Back Panel	96.0	95	92	101

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Medium / (R) Front Seat - Grime - Small / Instrument Panel - Traces of Adhesive Tape - Yes / (R) Front Trim - Worked - Large / Rear Seat - Grime - Medium / (L) Front Trim - Worked - Large	Remarks (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
with Ito plates, ni warranty booklet, with spare tire, jack and tools, with hairline scratches in the body,