

General Information

Date & Time: 31, Jul, 2026 16:03

Make	Toyota	Model	Vios
YOM	2021	Odo Meter Reading	51,549
Registration No.	FAF4002	Chassis No.	PA1B18F31M4134217
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



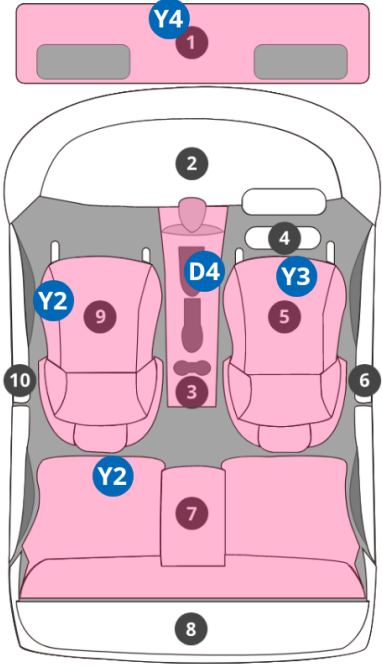
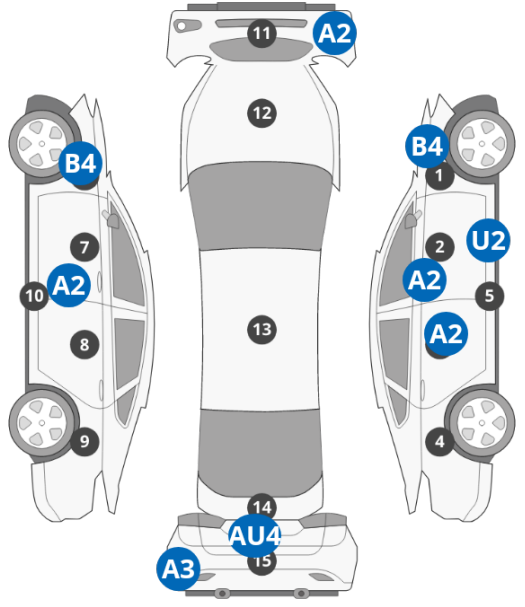
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	90.6	91	90	91
2	Boot Lid	197.3	171	202	219
3	Roof	82.4	86	77	89/78
4	Left Front Fender				
5	Left Front Door	89.9	97	89	84
6	Center Panel Left				
7	Left Rear Door	93.3	96	93	91
8	Left Back Panel	94.9	98	93	94
9	Right Front Fender				
10	Right Front Door	88.2	87	87	91
11	Center Panel Right				
12	Right Rear Door	94.1	90	96	96
13	Right Back Panel	89.7	87	87	95

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Large / (R) Front Seat - Grime - Medium / Console, Switchs, Vents - Worked - Large / Rear Seat - Grime - Small / (L) Front Seat - Grime - Small / Room Mirror - Missing - Yes	Remarks (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Front Fender, Molding - Modified - Large / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Large / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Modified - Large / Front Bumper, Grille, Lamps - Scratch - Small
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Air Conditioner - Function - Weak / Battery - Weak - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
Ito plates not installed, no warranty bookket, jack, tools and spare tire. with hairline scratches in the body, sign of burn in the engine, front fenders replaced