

General Information

Date & Time: 29, Jul, 2026 15:54

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	67,487
Registration No.	NIJ5606	Chassis No.	PA1B18F31P4204500
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



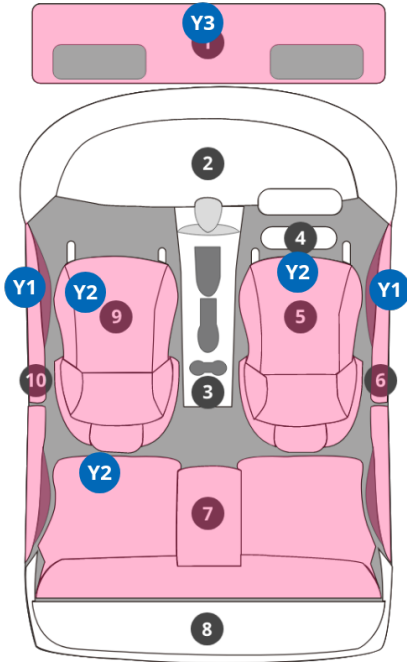
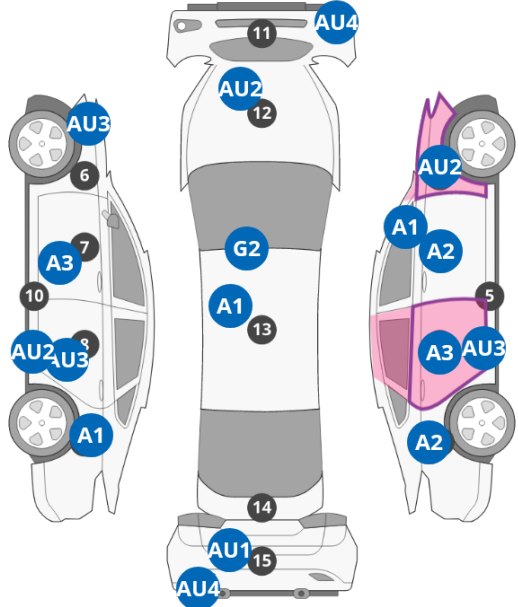
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.6	114	107	120
2	Boot Lid	113.3	115	107	118
3	Roof	91.5	95	90	88/93
4	Left Front Fender	101.6	100	103	102
5	Left Front Door	102.0	102	104	100
6	Center Panel Left				
7	Left Rear Door	106.0	109	103	106
8	Left Back Panel	108.3	114	109	102
9	Right Front Fender	153.3	183	125	152
10	Right Front Door	153.0	147	139	173
11	Center Panel Right				
12	Right Rear Door	157.3	175	130	167
13	Right Back Panel	317.0	146	221	584

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Medium / (R) Front Trim - Grime - Minimal / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / (L) Front Trim - Grime - Minimal / (L) Front Seat - Grime - Small	Remarks (R) Step - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch & Dent - Small / Roof - Scratch - Minimal / Front Windshield - Scratch, Stone chip - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes

With Lto plate, with spare tire and jack, 2keys, no warranty booklet and tools, scratches on headlights and taillights, worn tires, visible hairlines scratches on vehicle, plate light issue