

General Information

Date & Time: 30, Jul, 2026 10:31

Make	Toyota	Model	Wigo
YOM	2022	Odo Meter Reading	264,121
Registration No.	EAF3886	Chassis No.	MHKAA4DE4FNJ004959
CC	1.0	Transmission	M/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



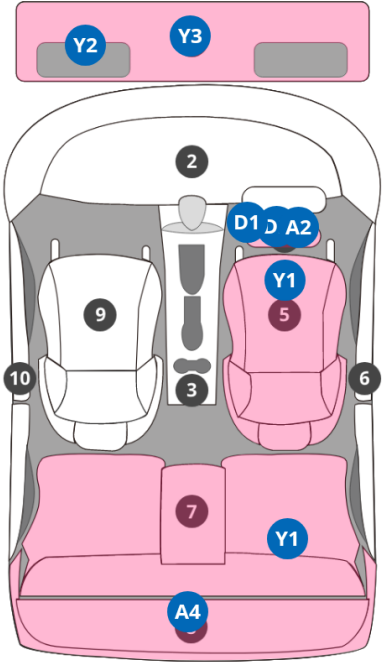
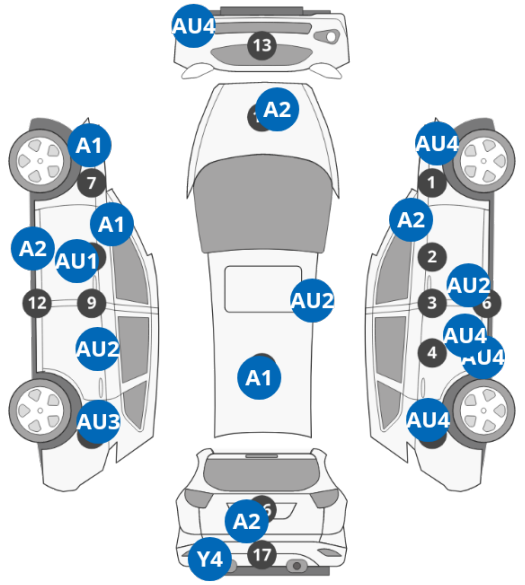
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	94.6	94	100	90
2	Boot Lid	101.4	98	104	102
3	Roof	80.2	70	79	81/90
4	Left Front Fender	96.4	91	98	101
5	Left Front Door	98.0	104	103	87
6	Center Panel Left				
7	Left Rear Door	100.7	89	106	107
8	Left Back Panel	98.8	101	98	98
9	Right Front Fender	102.0	108	105	93
10	Right Front Door	103.3	97	107	106
11	Center Panel Right				
12	Right Rear Door	95.5	102	95	89
13	Right Back Panel	105.3	99	111	106

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Medium / Sunvisor, Sunglass Holder - Grime - Small / Mat Other - Worked - Small / Rear Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / Trunk Room - Worn, Scratch, Cut, Crack - Large / (L) Front Floor Mat - Cut, Crack - Small / Carpet - Worked - Minimal	Remarks (R) Front Fender, Molding - Scratch & Dent - Large / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Crack, Gap - Large / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Mirror - Scratch - Minimal / Roof Spoiler, Molding - Scratch & Dent - Small / Roof - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (L) Front Fender, Molding - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
With Lto plate, with spare tire, 1key, no warranty booklet and tools and Jack, scratches on headlights, Crack taillight, trunk cover issue