

General Information

Date & Time: 30, Jul, 2026 10:41

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	27,754
Registration No.	NIP1900	Chassis No.	PA1B18F36P4207313
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



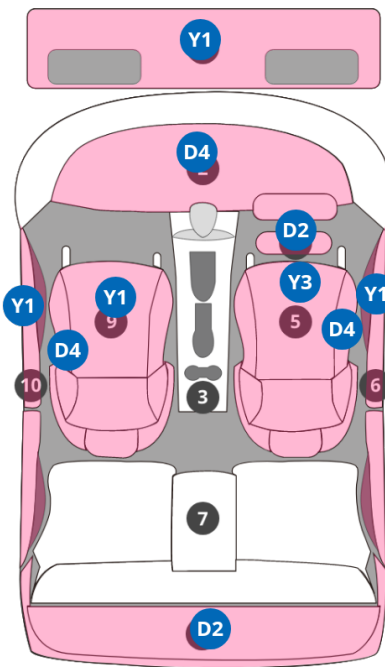
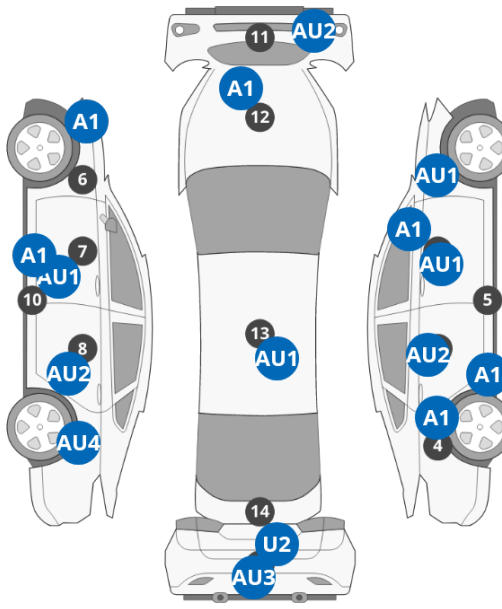
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.3	115	109	110
2	Boot Lid	111.6	116	105	114
3	Roof	91.0	94	89	91/90
4	Left Front Fender	99.6	98	101	100
5	Left Front Door	96.1	97	90	101
6	Center Panel Left				
7	Left Rear Door	92.9	90	89	100
8	Left Back Panel	110.5	114	118	100
9	Right Front Fender	94.9	89	98	98
10	Right Front Door	92.6	95	92	91
11	Center Panel Right				
12	Right Rear Door	93.6	97	91	94
13	Right Back Panel	102.0	101	100	105

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Minimal / Dashboard - Loose, Deformed - Large / (L) Front Trim - Grime - Minimal / (L) Front Floor Mat - Worked - Small / (L) Front Seat - Grime - Minimal / Trunk Room - Loose, Deformed - Small / (R) Front Trim - Grime - Minimal / (R) Front Seat - Grime - Medium / (R) Front Seat belt - Loose, Deformed - Large / (L) Front Seat belt - Loose, Deformed - Large	Remarks (R) Front Fender, Molding - Scratch & Dent - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Roof - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes / Reverse Camera - N/A - Yes / Seat Belts - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

With Lto plate, with warranty booklet and tools and Jack, 1key, no spare tire, scratches on headlights and taillights, traction control lamp on, AIRBAG warning lamp on, ABS warning lamp on,