

General Information

Date & Time: 29, Jul, 2026 15:52

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	60,024
Registration No.	CCA3327	Chassis No.	PA1B18F31P4227839
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blackish Red Mica		

Body / Panel Condition



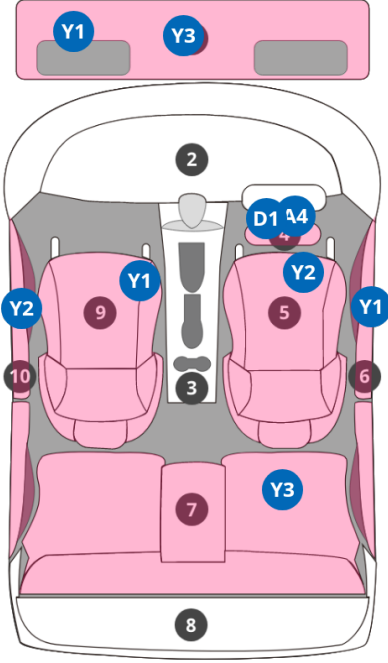
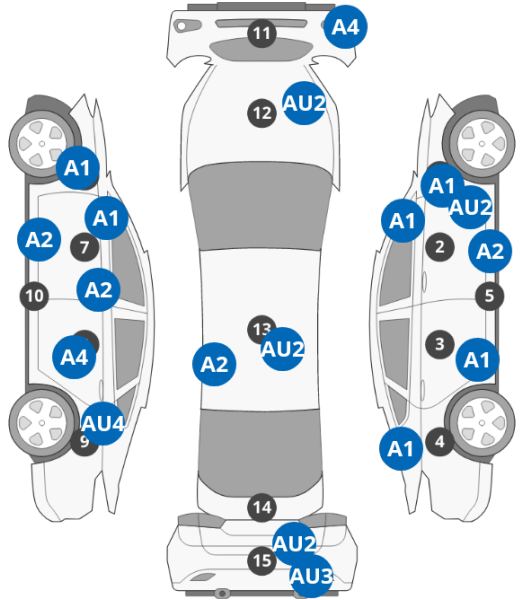
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	99.7	106	97	97
2	Boot Lid	110.0	107	106	117
3	Roof	94.4	97	97	93/91
4	Left Front Fender	99.7	100	101	98
5	Left Front Door	96.1	97	91	100
6	Center Panel Left				
7	Left Rear Door	104.3	103	110	100
8	Left Back Panel	105.3	107	107	102
9	Right Front Fender	104.3	101	106	106
10	Right Front Door	100.5	107	97	97
11	Center Panel Right				
12	Right Rear Door	104.5	95	100	119
13	Right Back Panel	106.3	103	102	114

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Medium / Sunvisor, Sunglass Holder - Grime - Minimal / Rear Seat - Grime - Medium / (R) Front Trim - Grime - Minimal / (R) Front Seat - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Cut, Crack - Large / Carpet - Worked - Minimal / (L) Front Seat - Grime - Minimal	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch - Large / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / Roof - Scratch & Dent - Small / Roof Spoiler, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Reverse Camera - N/A - Yes

Inspector Notes

With Lto plate, with spare tire and jack, 2keys, no warranty booklet and tools, scratches on headlights and taillights, left fender light issue,