


General Information

Date & Time: 30, Jul, 2026 10:34

Make	Toyota	Model	Hiace
YOM	2021	Odo Meter Reading	160,177
Registration No.	CAV8820	Chassis No.	JTFJ02P7L5024137
CC	3.0	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	White		

Body / Panel Condition

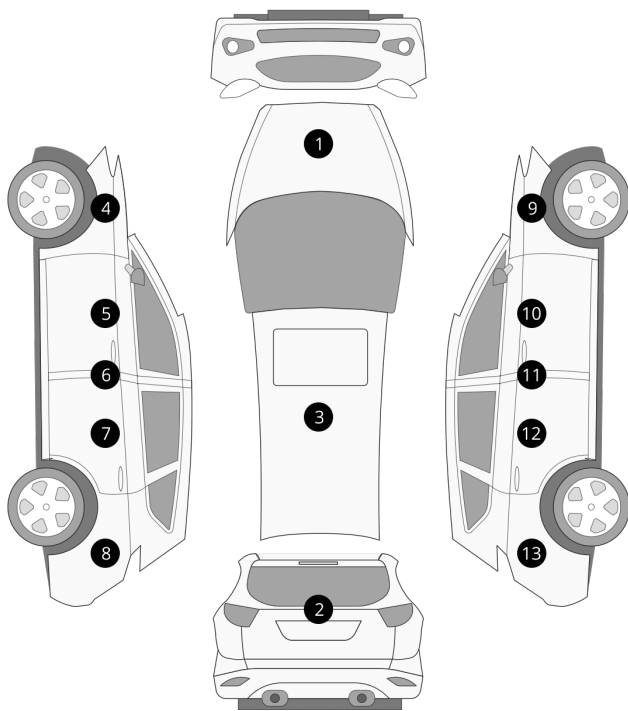

#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	84.1	80	83	90
2	Boot Lid	74.0	74	76	73
3	Roof	68.4	66	68	65/75
4	Left Front Fender	84.8	78	97	79
5	Left Front Door	68.1	73	61	71
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	64.8	65	63	66
9	Right Front Fender	86.7	88	86	86
10	Right Front Door	64.3	68	63	62
11	Center Panel Right	64.8	73	63	59
12	Right Rear Door	65.1	67	65	64
13	Right Back Panel	74.1	71	75	77

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Grime - Minimal / (L) Front Floor Mat - Cut, Crack - Medium / (R) Front Trim - Grime - Minimal / Ceiling - Grime - Large / Trim Other - Loose, Deformed - Large / (R) Rear Trim - Cut, Crack - Medium / Overall Interior - Worn as per age - Yes	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Center Panel - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Large / Roof - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch - Medium / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Side Window - Scratch, Stone chip - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
With Lto plate, with spare tire and warranty booklet, 1key, no jack and tools, scratches on headlights and taillights, battery weak, rear seat issue