

General Information

Date & Time: 03, Mar, 2025 13:18

Make	Toyota	Model	Vios
YOM	2024	Mileage	16,950
Registration No.	NHM7721	Chassis No.	PA1B18F33R4239316
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



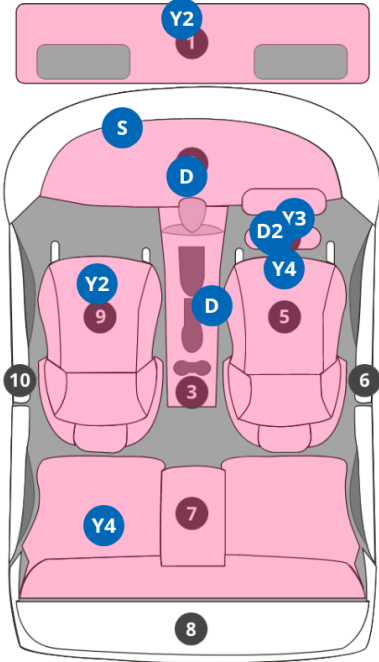
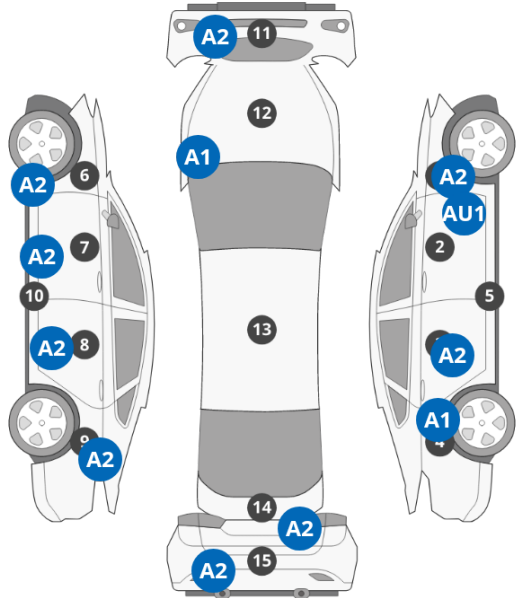
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.6	117	111	107
2	Boot Lid	103.3	98	101	111
3	Roof	103.2	115	96	100/102
4	Left Front Fender	96.8	94	100	96
5	Left Front Door	384.3	767	175	211
6	Center Panel Left				
7	Left Rear Door	104.0	109	103	100
8	Left Back Panel	101.4	100	107	97
9	Right Front Fender	126.3	139	103	137
10	Right Front Door	100.0	103	100	97
11	Center Panel Right				
12	Right Rear Door	106.3	100	106	113
13	Right Back Panel	104.3	102	99	112

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Mat Other - Grime - Large / Rear Seat - Grime - Large / (R) Front Floor Mat - Grime - Medium / (R) Front Seat - Grime - Large / (L) Front Floor Mat - Worked - Small / Console, Switchs, Vents - Traces of Adhesive Tape - Yes / Instrument Panel - Traces of Adhesive Tape - Yes / Ceiling - Grime - Small / Overall Interior - Smell - Yes	Remarks (L) Front Door - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet, with jack and incomplete tools, with spare tire, with LTO plate