

General Information

Date & Time: 29, Jul, 2026 15:54

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	20,910
Registration No.	NIH1077	Chassis No.	PA1B18F33N4197336
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



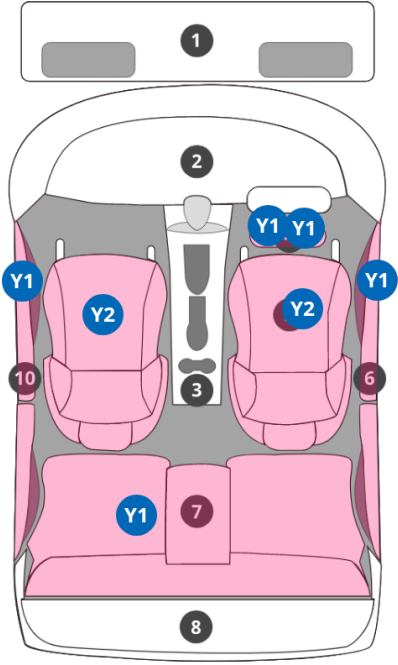
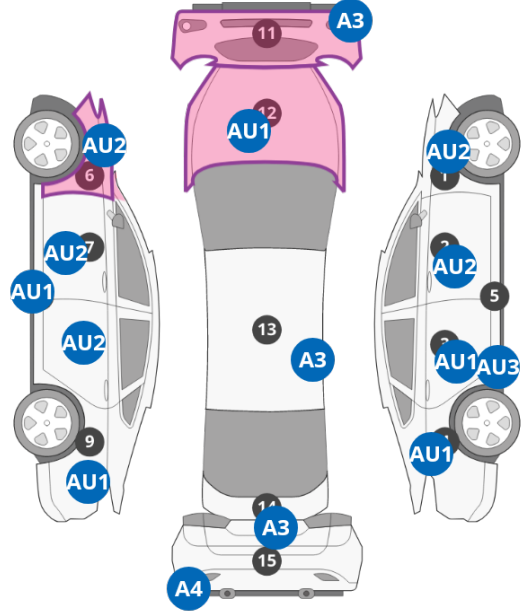
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.3	106	108	114
2	Boot Lid	117.6	120	112	121
3	Roof	105.5	107	108	102/105
4	Left Front Fender	106.0	105	106	107
5	Left Front Door	113.3	112	110	118
6	Center Panel Left				
7	Left Rear Door	114.0	115	116	111
8	Left Back Panel	119.0	129	112	116
9	Right Front Fender	108.0	111	105	108
10	Right Front Door	113.0	114	109	116
11	Center Panel Right				
12	Right Rear Door	111.0	108	108	117
13	Right Back Panel	108.0	106	106	112

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Minimal / Rear Seat - Grime - Minimal / (L) Front Floor Mat - Grime - Minimal / (R) Front Floor Mat - Grime - Minimal	Remarks (L) Front Fender - Repair Traces - Yes / Bonnet, Headlight - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch & Dent - Minimal / Roof - Scratch - Medium / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Medium / Front Bumper, Grille, Lamps - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, with spare tire, with jack, no warranty and manual booklet, no spare key, no reverse camera, no tools, scratches and dent on exterior, scratches in taillight and headlight, rear view mirror missing, trunk tire cover missing, whole body have bird drop.