

General Information

Date & Time: 31, Jul, 2026 12:16

Make	Nissan	Model	NV350
YOM	2018	Odo Meter Reading	78,018
Registration No.	NCP6419	Chassis No.	JNT1CE26Z0016444
CC	2.5	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	White		

Body / Panel Condition



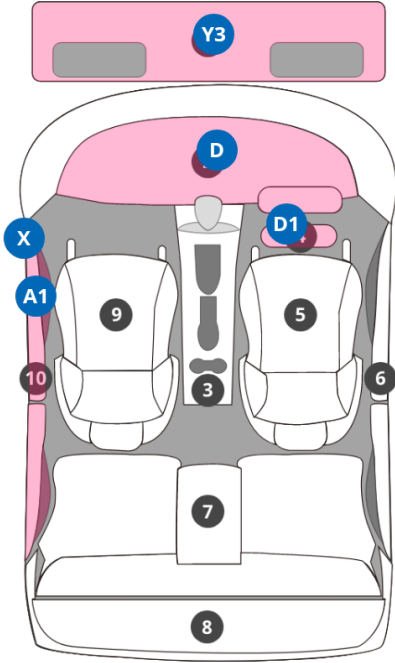
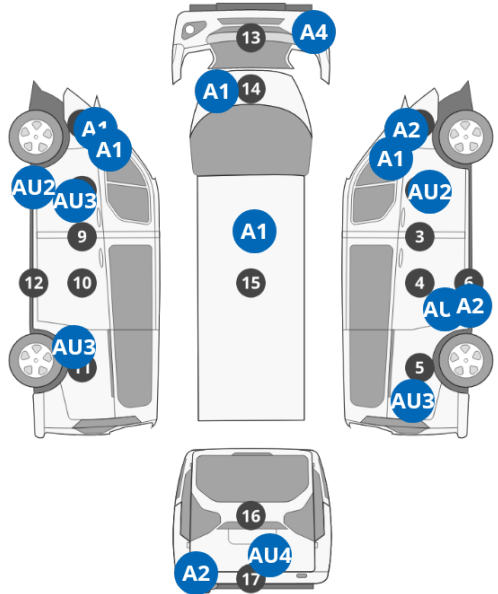
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	130.4	83	82	226
2	Boot Lid	211.0	120	139	374
3	Roof	81.9	100	74	78/76
4	Left Front Fender	117.9	69	191	93
5	Left Front Door	78.3	83	70	82
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	85.5	105	76	76
9	Right Front Fender	88.2	85	90	90
10	Right Front Door	73.4	77	66	78
11	Center Panel Right	77.4	83	78	71
12	Right Rear Door	122.0	118	119	129
13	Right Back Panel	92.7	100	106	72

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Traces of Adhesive Tape - Yes / (L) Front Trim - Cut, Crack - Minimal / Carpet - Worked - Minimal / Ceiling - Grime - Medium / Trim Other - Missing - Yes	Remarks Front Panel - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Front Fender, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Large / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Roof - Scratch - Minimal / Front Panel - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Air Conditioner - Function - Weak / Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
With Lto plate, with spare tire and jack, 1key, no warranty booklet and tools, scratches on headlights and taillights, battery weak, aircon issue, left rear window issue,