

General Information

Date & Time: 31, Jul, 2026 15:15

Make	Chevrolet	Model	Colorado
YOM	2017	Odo Meter Reading	117,587
Registration No.	LAB2370	Chassis No.	MMM148MK0HH618090
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	White		

Body / Panel Condition



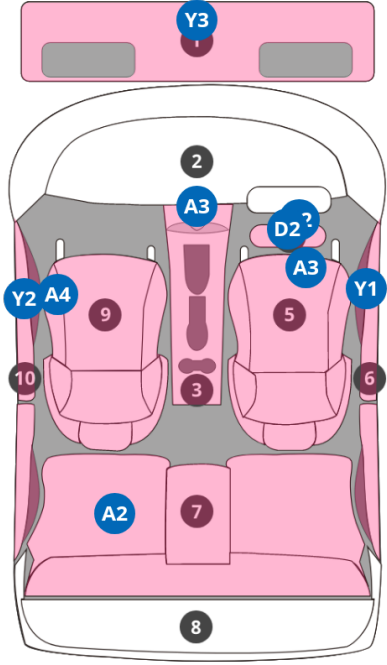
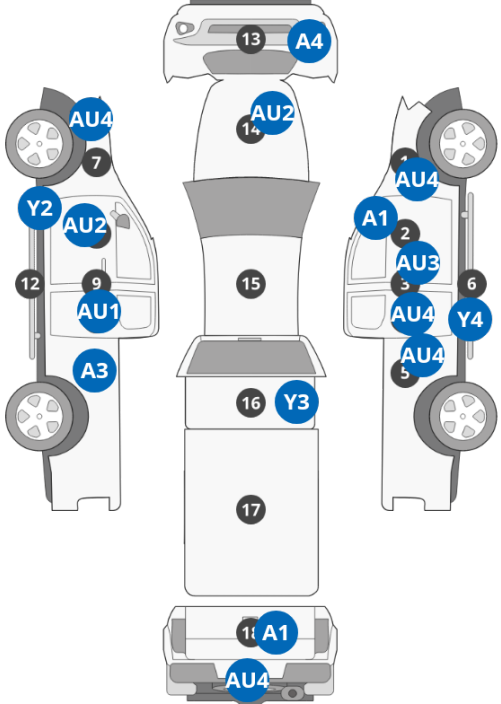
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	142.6	146	139	143
2	Boot Lid	124.0	129	118	125
3	Roof	129.7	129	130	128/132
4	Left Front Fender	140.0	142	146	132
5	Left Front Door	138.6	140	143	133
6	Center Panel Left				
7	Left Rear Door	138.0	145	132	137
8	Left Back Panel	138.6	138	140	138
9	Right Front Fender	134.0	134	156	112
10	Right Front Door	137.0	135	141	135
11	Center Panel Right				
12	Right Rear Door	137.3	143	136	133
13	Right Back Panel	132.3	138	140	119

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Medium / Rear Seat - Fray - Small / Mat Other - Worked - Small / (R) Front Trim - Grime - Minimal / (R) Front Seat - Fray - Medium / (R) Front Floor Mat - Worked - Small / (L) Front Trim - Grime - Small / (L) Front Seat - Cut, Crack - Large / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Medium	Remarks (R) Front Fender, Molding - Scratch & Dent - Large / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Crack, Gap - Large / (R) Side Gate - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Rear Gate - Scratch - Minimal / (L) Side Gate - Scratch - Medium / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Step, In-panel, Side Spoiler - Crack, Gap - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch & Dent - Small / Roof - Crack, Gap - Medium
Frame Evaluation : A	Functional Evaluation : D
Remarks Defects not found	Remarks Power Seat - Issue - Yes / Air Conditioner - Function - Weak / Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes

With Lto plate, 1key, no warranty booklet and tools, no spare tire and jack, faded headlights, scratches on taillights, battery weak, aircon issue,plate light issue