

General Information

Date & Time: 31, Jul, 2026 12:18

Make	Isuzu	Model	D-MAX
YOM	2015	Odo Meter Reading	117,478
Registration No.	FAM4594	Chassis No.	PABTFR86DF2000983
CC	2.5	Transmission	M/T
Fuel Type	Diesel	Type of Body	Double Cab. Pick-Up
Colour	Silver		

Body / Panel Condition



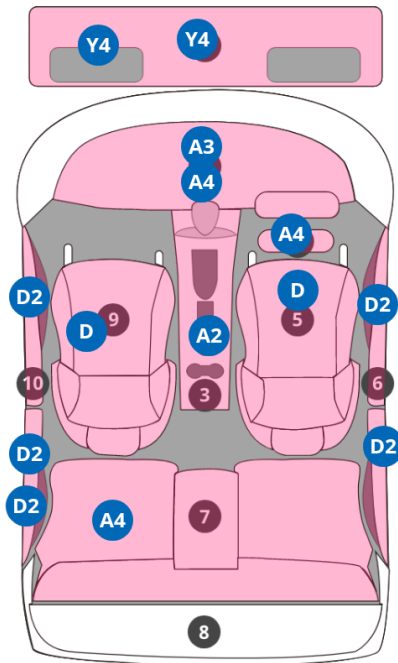
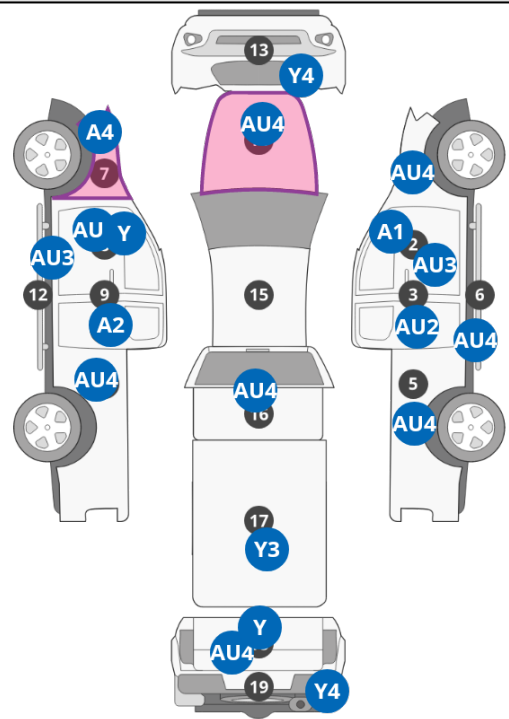
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	7.7	7	7	9
2	Boot Lid	345.6	301	419	317
3	Roof	580.2	753	1,091	252/225
4	Left Front Fender	458.6	662	460	254
5	Left Front Door	412.0	276	428	532
6	Center Panel Left				
7	Left Rear Door	390.3	484	305	382
8	Left Back Panel	296.0	287	275	326
9	Right Front Fender	156.0	157	120	191
10	Right Front Door	391.6	459	355	361
11	Center Panel Right				
12	Right Rear Door	302.6	277	264	367
13	Right Back Panel	440.3	337	297	687

Overall Evaluation :

E

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Worn as per age - Yes / Ceiling - Grime - Large / Sunvisor, Sunglass Holder - Grime - Large / Dashboard - Worn, Scratch, Cut, Crack - Medium / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Small / (R) Front Seat - Worn - Yes / (R) Rear Trim - Worked - Small / (R) Front Trim - Worked - Small / Rear Seat - Cut, Crack - Large / (L) Rear Trim - Worked - Small / (L) Front Trim - Worked - Small / (L) Front Seat - Worn - Yes / Carpet - Worn, Scratch, Cut, Crack - Large / Steering Wheel - Worn, Peel, Crack - Large / Room Mirror - Missing - Yes / Trim Other - Worked - Small	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Corner Panel - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Overall Exterior - Worn as per age - Yes / (R) Front Fender, Molding - Scratch & Dent - Large / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Side Gate - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Crack, Gap - Large / Rear Gate - Scratch & Dent - Large / Cargo Bed Floor - Crack, Gap - Medium / (L) Side Gate - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (L) Front Fender, Molding - Repair mark - Difference in Color / (L) Front Fender, Molding - Scratch - Large / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Repair mark - Difference in Color / Bonnet, Headlight - Scratch & Dent - Large / Roof - Scratch & Dent - Large / (L) Mirror - Crack - Damaged / Antennae - Damaged - Yes
Frame Evaluation : D	Functional Evaluation : E
Remarks Front Cross Member Support - Condition of Welding ? - Yes / Left Front Inside Panel (Front Side) - Condition of Welding, Hardness and Shape of Sealant ? - Yes / Left Front Inside (Rear Side) - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Panel, Meter - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Air Conditioner - Function - Weak / Reverse Camera - N/A - Yes / Turn Signal, Hazard Flasher - Issue - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Seat Belts - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
No Lto plate, with spare tire, 1key, no warranty booklet and tools and Jack, faded headlights ,Crack taillight, hood lock issue, rear door lock issue, left front door issue, check engine warning lamp on, ABS warning lamp on, aircon issue,