

General Information

Date & Time: 03, Aug, 2026 22:27

Make	Toyota	Model	Rush
YOM	2020	Odo Meter Reading	130,835
Registration No.	CAV1219	Chassis No.	MHKE8FF3PLK022414
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	Silver		

Body / Panel Condition



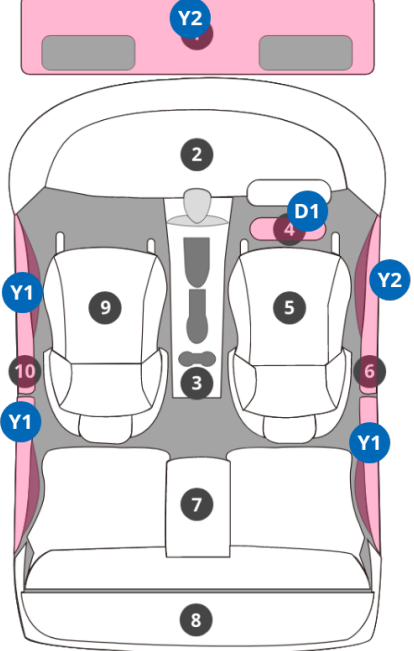
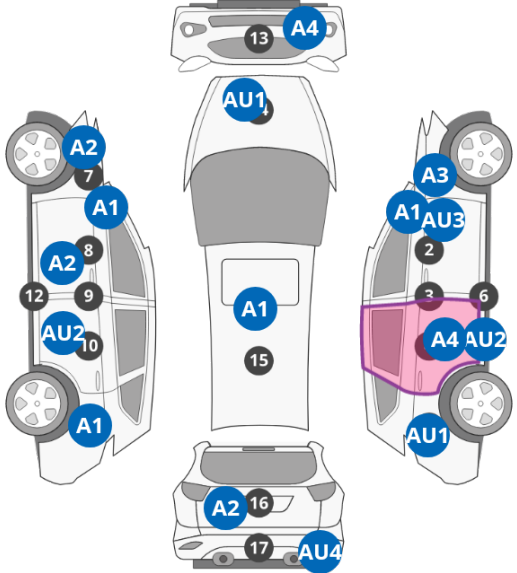
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.1	114	111	97
2	Boot Lid	108.6	105	107	114
3	Roof	96.1	80	86	110/109
4	Left Front Fender	110.5	122	120	90
5	Left Front Door	99.0	96	101	100
6	Center Panel Left				
7	Left Rear Door	102.4	94	111	102
8	Left Back Panel	107.0	106	102	113
9	Right Front Fender	101.7	99	107	100
10	Right Front Door	104.9	100	107	108
11	Center Panel Right				
12	Right Rear Door	134.3	125	149	129
13	Right Back Panel	102.3	111	97	99

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / (L) Front Trim - Grime - Minimal / (L) Rear Trim - Grime - Minimal / (R) Front Trim - Grime - Small / Carpet - Worked - Minimal / (R) Rear Trim - Grime - Minimal	Remarks (R) Front Fender, Molding - Scratch - Medium / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / Roof - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch & Dent - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
With Lto plate, with spare tire and jack, 1key, no warranty booklet and tools, scratches on headlights and taillights,