

General Information

Date & Time: 03, Aug, 2026 19:52

Make	Toyota	Model	Avanza
YOM	2019	Odo Meter Reading	51,218
Registration No.	NEA3137	Chassis No.	MHKM5FE3FKK002528
CC	1.5	Transmission	M/T
Fuel Type	Gas	Type of Body	Wagon
Colour	Black		

Body / Panel Condition



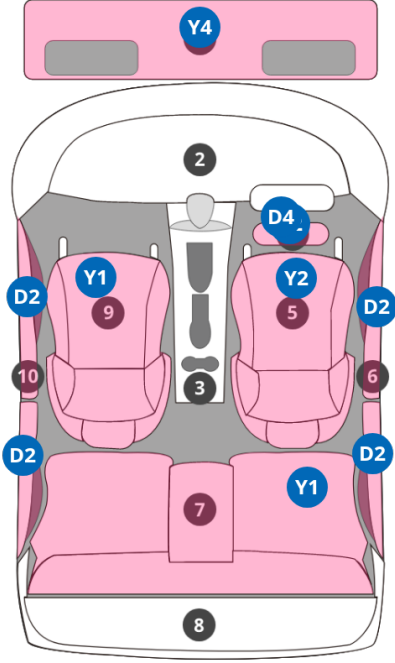
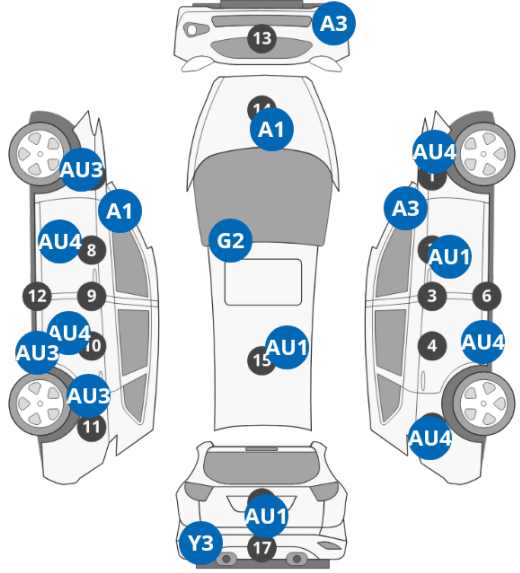
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	106.6	115	100	105
2	Boot Lid	95.0	83	106	96
3	Roof	86.9	83	84	90/90
4	Left Front Fender	95.1	81	101	103
5	Left Front Door	102.8	110	104	95
6	Center Panel Left				
7	Left Rear Door	97.3	100	100	92
8	Left Back Panel	85.4	83	92	82
9	Right Front Fender	99.3	102	102	94
10	Right Front Door	94.1	97	96	90
11	Center Panel Right				
12	Right Rear Door	96.9	93	97	101
13	Right Back Panel	82.4	86	89	73

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Large / Carpet - Worn, Scratch, Cut, Crack - Small / (R) Rear Trim - Worked - Small / Rear Seat - Grime - Minimal / (R) Front Trim - Worked - Small / (R) Front Seat - Grime - Small / (L) Rear Trim - Worked - Small / (L) Front Trim - Worked - Small / (L) Front Floor Mat - Worked - Large / (L) Front Seat - Grime - Minimal	Remarks (R) Front Fender, Molding - Scratch & Dent - Large / (R) Mirror - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Crack, Gap - Medium / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / Roof - Scratch & Dent - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Minimal / Front Windshield - Scratch, Stone chip - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
With Lto plate, with spare tire, 1key, no warranty booklet and tools and Jack, scratches on headlights and taillights, rear seat issue, handle at ceiling partially missing,