

General Information

Date & Time: 03, Aug, 2026 20:44

Make	Toyota	Model	Wigo
YOM	2023	Odo Meter Reading	31,182
Registration No.	NHF3388	Chassis No.	MHKAA4DE4FNJ005275
CC	1.0	Transmission	M/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Silver		

Body / Panel Condition



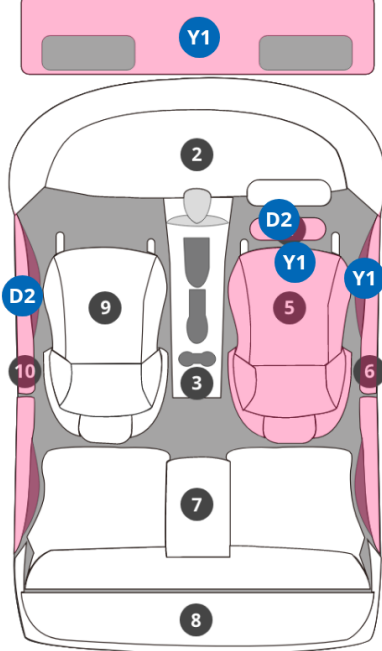
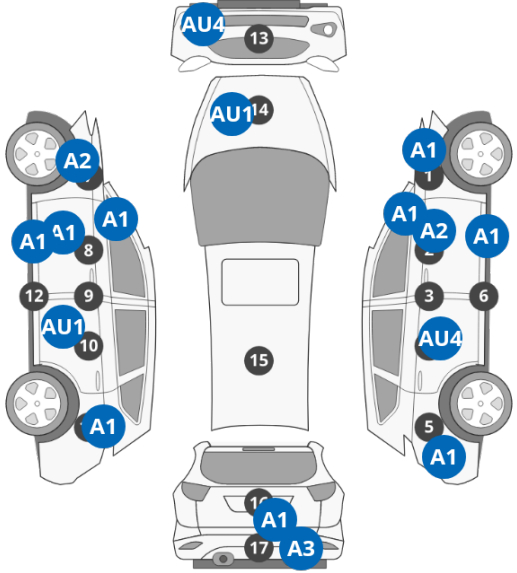
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	174.0	169	184	169
2	Boot Lid	162.3	149	177	161
3	Roof	148.5	139	162	149/144
4	Left Front Fender	157.6	158	158	157
5	Left Front Door	147.3	146	154	142
6	Center Panel Left				
7	Left Rear Door	155.3	151	150	165
8	Left Back Panel	155.3	156	153	157
9	Right Front Fender	154.0	167	159	136
10	Right Front Door	147.6	138	157	148
11	Center Panel Right				
12	Right Rear Door	145.6	154	142	141
13	Right Back Panel	166.6	165	157	178

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Minimal / (R) Front Trim - Grime - Minimal / (R) Front Seat - Grime - Minimal / (L) Front Trim - Worked - Small / (L) Front Floor Mat - Worked - Small	Remarks Bonnet - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch & Dent - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes

Inspector Notes
With Lto plate,with spare tire and jack, 2keys, no warranty booklet and tools, scratches on headlights and taillights,