

General Information

Date & Time: 03, Aug, 2026 18:04

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	101,380
Registration No.	NFE5531	Chassis No.	PA1B18F38N4185621
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



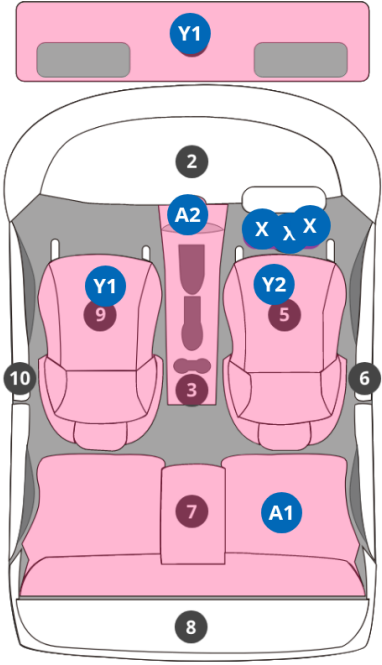
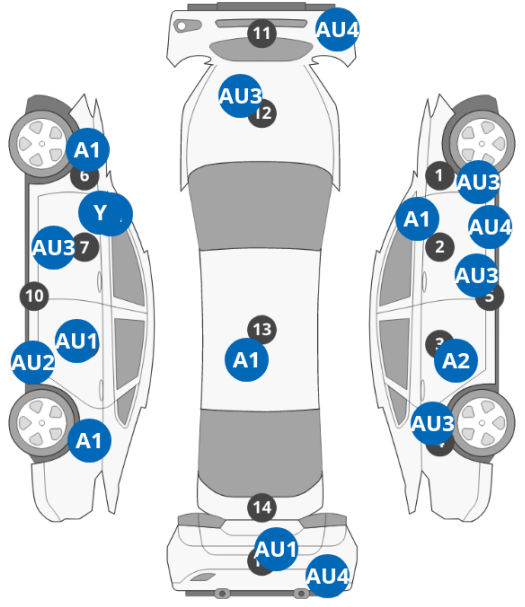
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.4	115	99	111
2	Boot Lid	106.3	107	100	112
3	Roof	90.1	94	88	95/83
4	Left Front Fender	175.6	186	151	190
5	Left Front Door	148.0	168	141	135
6	Center Panel Left				
7	Left Rear Door	95.5	87	100	100
8	Left Back Panel	110.3	115	105	111
9	Right Front Fender	101.3	100	103	101
10	Right Front Door	101.4	103	102	99
11	Center Panel Right				
12	Right Rear Door	105.0	104	101	110
13	Right Back Panel	107.0	107	103	111

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Minimal / Rear Seat - Cut, Crack - Minimal / Mat Other - Missing - Yes / (R) Front Floor Mat - Missing - Yes / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Minimal / (L) Front Floor Mat - Missing - Yes / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Small	Remarks (L) Front Fender - Repair Traces - Yes / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Medium / Roof - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch & Dent - Medium / (L) Mirror - Scratch - Minimal / (L) Mirror - Crack - Damaged
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes

Inspector Notes
With Lto plate, with spare tire, 2keys, no warranty booklet and tools and Jack, scratches on headlights and taillights, traction control lamp on, airbag warning lamp on, ABS warning lamp on, possible flooding, abnormal sound on engine