

General Information

Date & Time: 03, Aug, 2026 20:04

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	59,150
Registration No.	CBD7515	Chassis No.	PA1B18F39N4185028
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



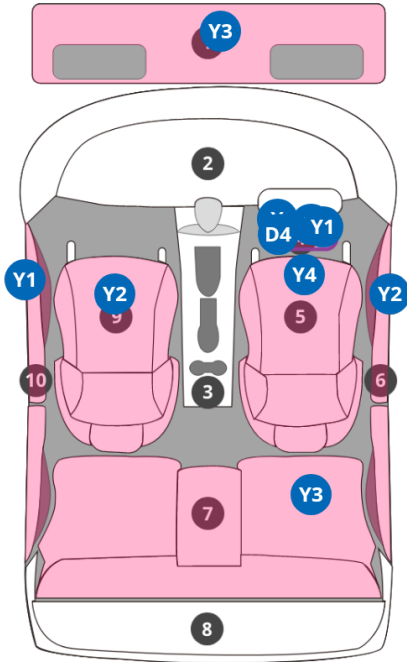
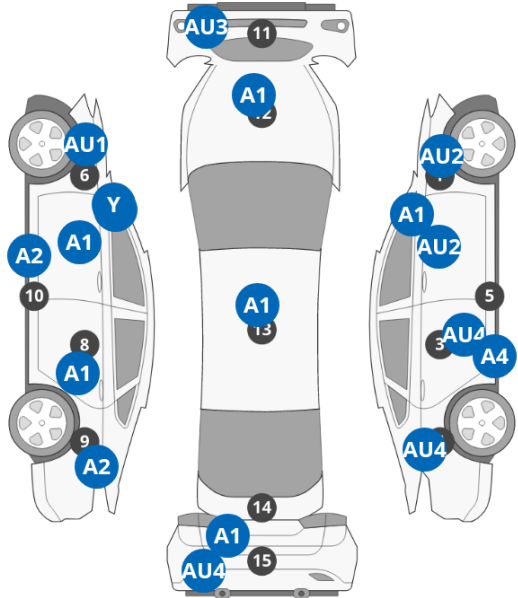
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.6	120	104	111
2	Boot Lid	110.6	112	101	119
3	Roof	96.2	106	89	100/90
4	Left Front Fender	105.3	103	106	107
5	Left Front Door	100.7	106	103	93
6	Center Panel Left				
7	Left Rear Door	102.6	102	103	103
8	Left Back Panel	114.3	113	113	117
9	Right Front Fender	102.6	106	100	102
10	Right Front Door	121.3	124	124	116
11	Center Panel Right				
12	Right Rear Door	103.1	99	100	111
13	Right Back Panel	103.6	101	104	106

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Medium / Rear Seat - Grime - Medium / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Minimal / (R) Front Seat - Grime - Large / (L) Front Seat - Grime - Small / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Grime - Minimal / Carpet - Worked - Large	Remarks (R) Front Fender, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch - Large / (R) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Small / Roof - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Minimal / (L) Mirror - Crack - Damaged
Frame Evaluation : A	Functional Evaluation : D
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes / Air Conditioner - Function - Weak / Reverse Camera - N/A - Yes

Inspector Notes
With Lto plate, with jack, 2keys, no spare tire and warranty booklet and tools, scratches on headlights and taillights, check engine warning lamp on, traction control lamp on, maintenance warning lamp on, airbag warning lamp on, ABS warning lamp on, aircon issue