

General Information

Date & Time: 03, Mar, 2025 18:43

Make	Toyota	Model	Vios
YOM	2024	Mileage	11,218
Registration No.	NHM3380	Chassis No.	PA1B18F35R4239480
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



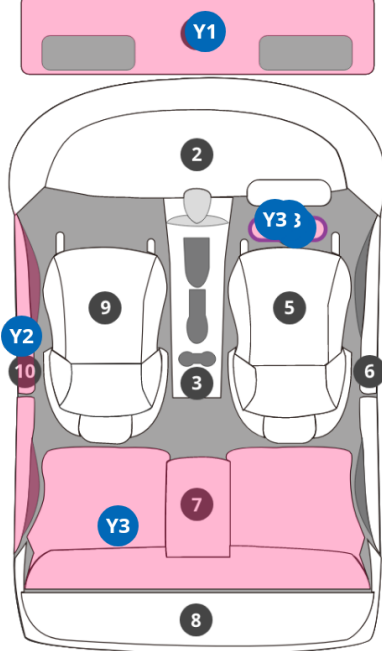
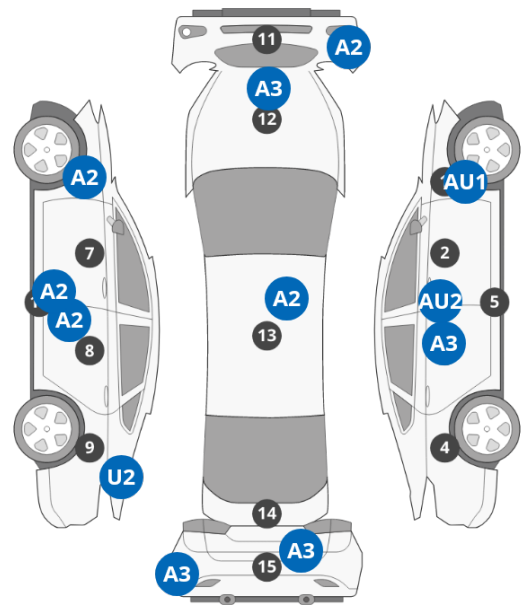
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.6	111	120	113
2	Boot Lid	102.1	102	96	108
3	Roof	101.3	100	112	87/106
4	Left Front Fender	96.3	101	89	99
5	Left Front Door	91.9	92	88	96
6	Center Panel Left				
7	Left Rear Door	100.3	104	100	98
8	Left Back Panel	104.6	111	104	99
9	Right Front Fender	97.0	97	95	99
10	Right Front Door	98.8	102	95	100
11	Center Panel Right				
12	Right Rear Door	101.9	100	103	103
13	Right Back Panel	112.0	107	115	114

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Mat Other - Missing - Yes / (R) Front Floor Mat - Grime - Medium / (L) Front Floor Mat - Grime - Medium / Rear Seat - Grime - Medium / (L) Front Trim - Grime - Small / Ceiling - Grime - Minimal	Remarks (R) Front Fender, Molding - Scratch & Dent - Minimal / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Small / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
no warranty booklet, with jack, no tools, with spare tire, with LTO plate