

General Information

Date & Time: 04, Mar, 2025 16:01

Make	Toyota	Model	Wigo
YOM	2022	Mileage	38,041
Registration No.	NFE7010	Chassis No.	MHKA4DF5FNJ071450
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Black		

Body / Panel Condition



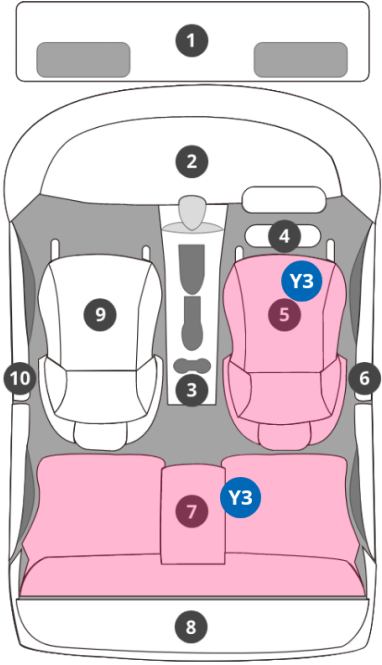
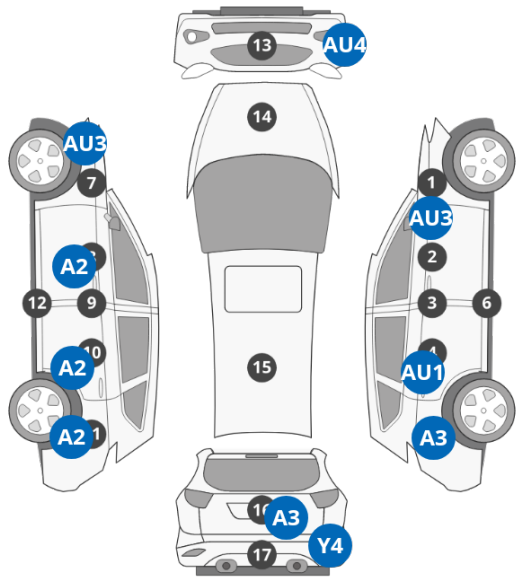
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	100.7	104	104	94
2	Boot Lid	100.6	100	99	103
3	Roof	89.9	87	89	99/85
4	Left Front Fender	96.8	84	100	106
5	Left Front Door	96.9	99	97	95
6	Center Panel Left				
7	Left Rear Door	94.2	94	92	97
8	Left Back Panel	94.6	97	96	91
9	Right Front Fender	98.0	105	98	91
10	Right Front Door	97.2	98	100	94
11	Center Panel Right				
12	Right Rear Door	95.0	101	93	92
13	Right Back Panel	100.5	110	91	101

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Medium / (R) Front Seat - Grime - Medium	Remarks Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Crack, Gap - Large / Trunk Hood, Rear Gate - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet/ with jack and spare tire/ with LTO plate/ no tools/ no high beam/ plate light issue