

General Information

Date & Time: 04, Mar, 2025 16:46

Make	Toyota	Model	Wigo
YOM	2022	Mileage	31,790
Registration No.	NFI8493	Chassis No.	MHKA4DF5FMJ063319
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Silver		

Body / Panel Condition



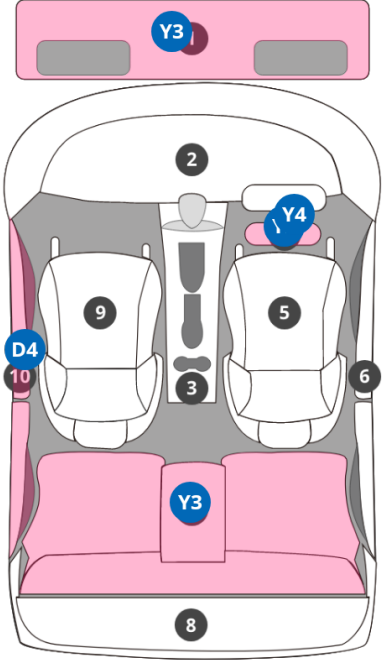
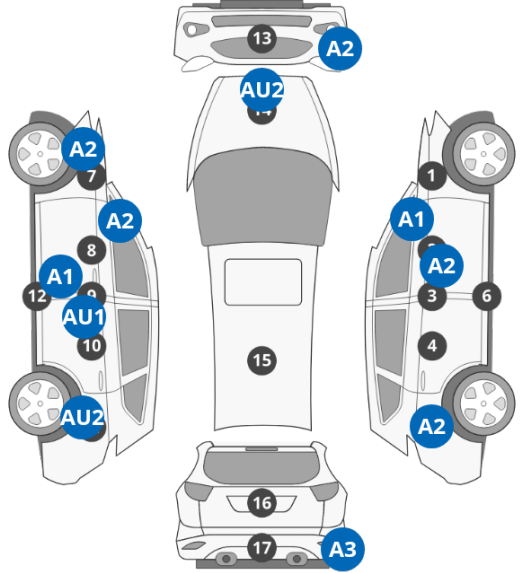
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	92.2	86	96	95
2	Boot Lid	99.6	99	92	108
3	Roof	86.4	79	85	104/78
4	Left Front Fender	95.2	90	102	94
5	Left Front Door	94.3	94	93	96
6	Center Panel Left				
7	Left Rear Door	95.1	93	95	97
8	Left Back Panel	92.0	95	97	84
9	Right Front Fender	91.7	93	100	82
10	Right Front Door	87.6	86	96	81
11	Center Panel Right				
12	Right Rear Door	92.1	93	90	94
13	Right Back Panel	99.3	99	101	98

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Mat Other - Grime - Small / Rear Seat - Grime - Medium / (R) Front Floor Mat - Grime - Large / (L) Front Trim - Worked - Large / Ceiling - Grime - Medium	Remarks (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Small / (L) Mirror - Scratch - Small
Frame Evaluation : B	Functional Evaluation : A
Remarks Center Floor Panel - Bulge (Cuts, Major Deforms) or Corrosion ? - Yes	Remarks Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet, with jack and tools, with spare tire, with LTO plate