

General Information

Date & Time: 04, Mar, 2025 14:26

Make	Toyota	Model	Vios
YOM	2024	Mileage	13,771
Registration No.	BAG3305	Chassis No.	PA1B18F32R4256298
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



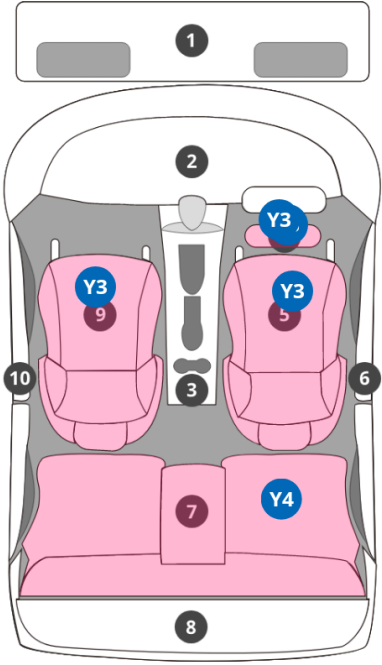
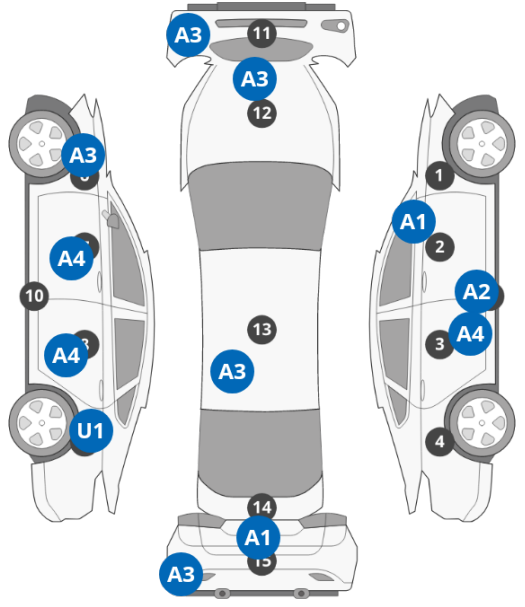
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.6	113	112	110
2	Boot Lid	112.3	133	101	103
3	Roof	100.3	108	98	92/103
4	Left Front Fender	91.3	93	89	92
5	Left Front Door	100.7	117	92	93
6	Center Panel Left				
7	Left Rear Door	101.5	115	98	92
8	Left Back Panel	106.6	120	100	100
9	Right Front Fender	98.5	103	95	98
10	Right Front Door	112.3	127	114	96
11	Center Panel Right				
12	Right Rear Door	106.4	99	100	120
13	Right Back Panel	106.3	102	101	116

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Grime - Medium / (R) Front Floor Mat - Grime - Medium / Rear Seat - Grime - Large / (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium	Remarks (L) Rear Fender, Molding - Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Door, Molding - Scratch - Large / (L) Front Door, Molding - Scratch - Large / (L) Front Fender, Molding - Scratch - Medium / Bonnet, Headlight - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Large / Roof - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (R) Mirror - Scratch, Peeled - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

with LTO plate/with spare tire/jack and incomplete tools/Without warranty booklet/ hairlines around the vehicle