

General Information

Date & Time: 05, Mar, 2025 14:55

Make	Toyota	Model	Avanza
YOM	2021	Mileage	80,932
Registration No.	DAV4596	Chassis No.	MHKM5FF3FMK006213
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	MPV
Colour	Gray		

Body / Panel Condition



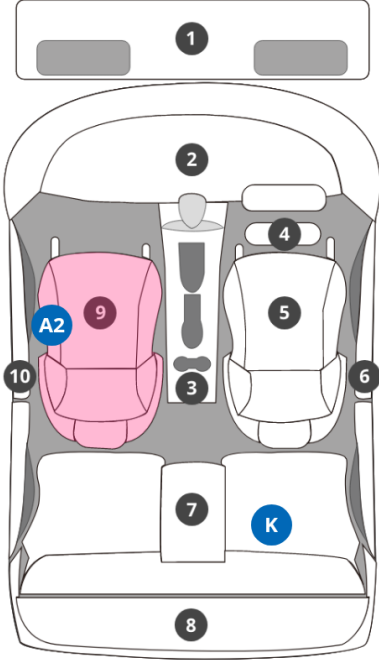
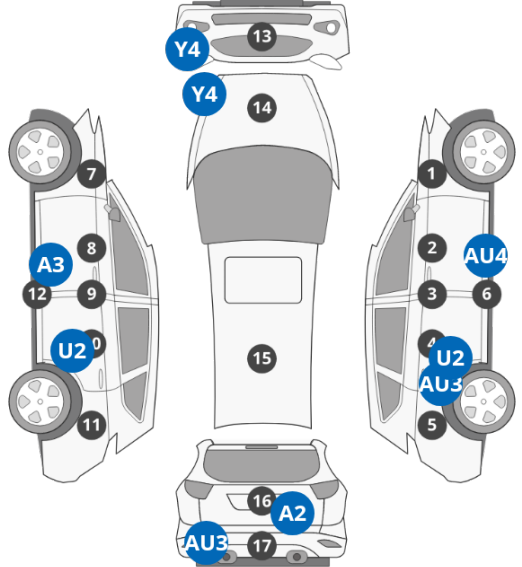
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	247.3	189	203	350
2	Boot Lid	89.9	95	85	90
3	Roof	96.7	95	88	108/97
4	Left Front Fender	148.0	143	149	152
5	Left Front Door	100.8	112	98	92
6	Center Panel Left				
7	Left Rear Door	98.2	91	105	99
8	Left Back Panel	83.6	72	83	96
9	Right Front Fender	90.6	89	95	88
10	Right Front Door	89.2	90	86	93
11	Center Panel Right				
12	Right Rear Door	112.6	110	123	105
13	Right Back Panel	111.6	159	100	76

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Cut, Crack - Small / Overall Interior - Animal Hair - Yes / Overall Interior - Worn as per age - Yes	Remarks Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Bonnet, Headlight - Crack, Gap - Large / Front Bumper, Grille, Lamps - Crack, Gap - Large / (L) Front Door, Molding - Scratch - Medium / (L) Rear Door, Molding - Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Dent - Small
Frame Evaluation : B	Functional Evaluation : C
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Air Conditioner - Function - Weak / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet and LTO plate/ with spare tire and jack/ with tools/