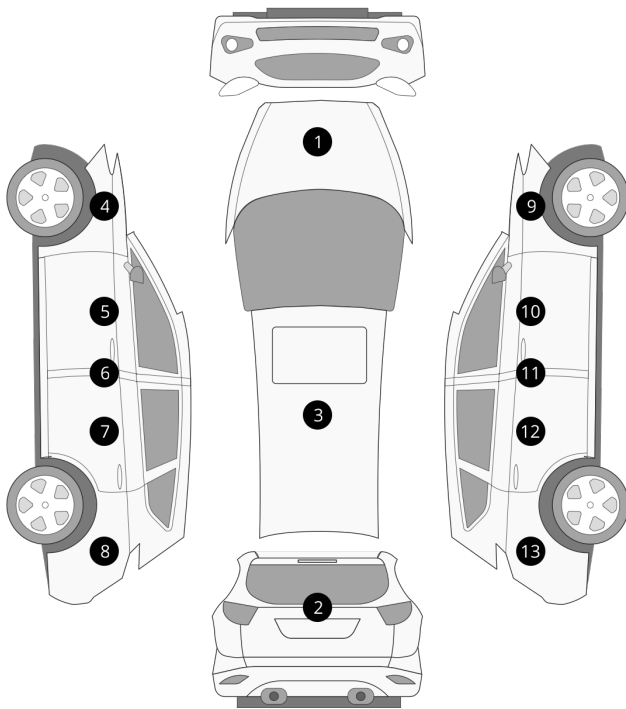


General Information

Date & Time: 10, Mar, 2025 10:59

Make	Lexus	Model	LM
YOM	2021	Mileage	97,150
Registration No.	NFD8168	Chassis No.	JTHABAAB1M8001460
CC	3.5	Transmission	A/T
Fuel Type	Gas	Type of Body	Van
Colour	Black		

Body / Panel Condition



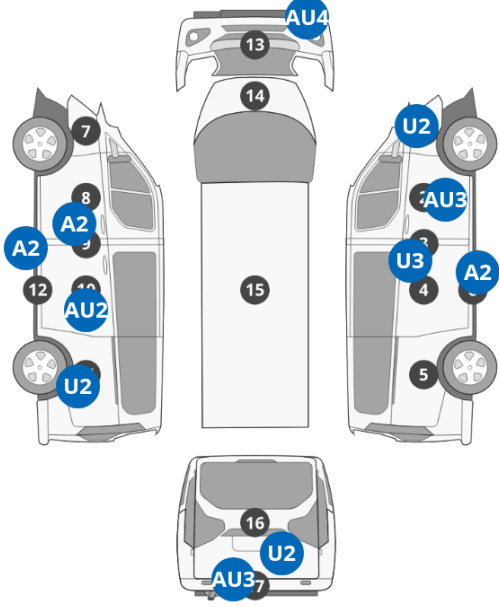
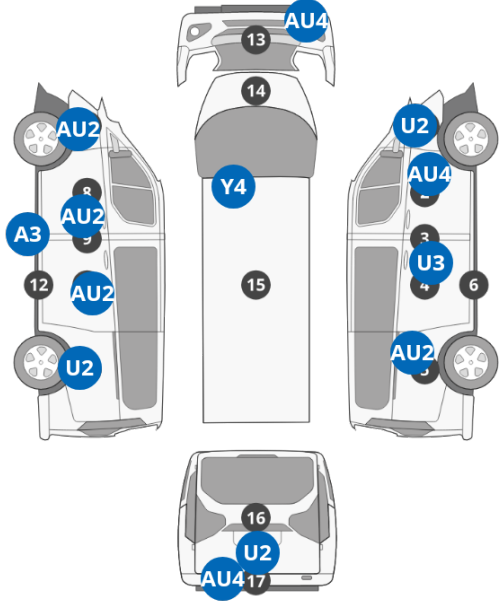
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	145.0	144	153	138
2	Boot Lid	113.0	116	110	113
3	Roof	130.5	124	128	135/135
4	Left Front Fender	118.6	111	126	119
5	Left Front Door	137.0	136	140	135
6	Center Panel Left				
7	Left Rear Door	135.0	131	139	135
8	Left Back Panel	135.0	140	138	127
9	Right Front Fender	122.0	119	132	115
10	Right Front Door	134.3	130	138	135
11	Center Panel Right				
12	Right Rear Door	131.0	130	137	126
13	Right Back Panel	134.3	111	143	149

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Worn - Yes / (L) Front Seat - Worn - Yes / Rear Seat - Worn - Yes	Remarks Front Bumper, Grille, Lamps - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (R) Rear Door, Molding - Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Medium / (R) Front Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Dent - Small / (L) Rear Fender, Molding - Dent - Small / Front Windshield - Damaged - Large
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet/ with LTO plate/ with jack and spare tire/ rear door issue / crack on front windshield/ guttermarks on wheels