

General Information

Date & Time: 19, Mar, 2025 14:25

Make	Toyota	Model	Vios
YOM	2023	Mileage	25,394
Registration No.	NHF7631	Chassis No.	PA1B18F35P4221641
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



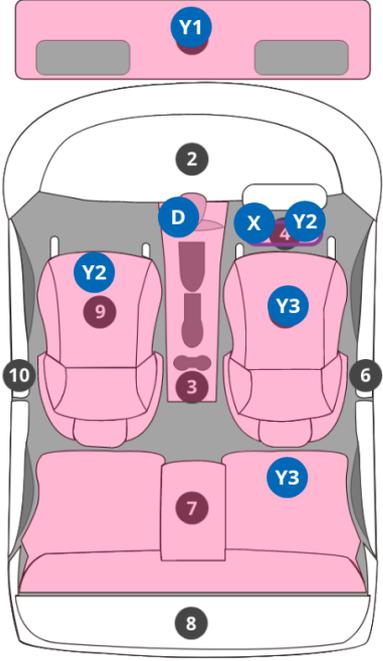
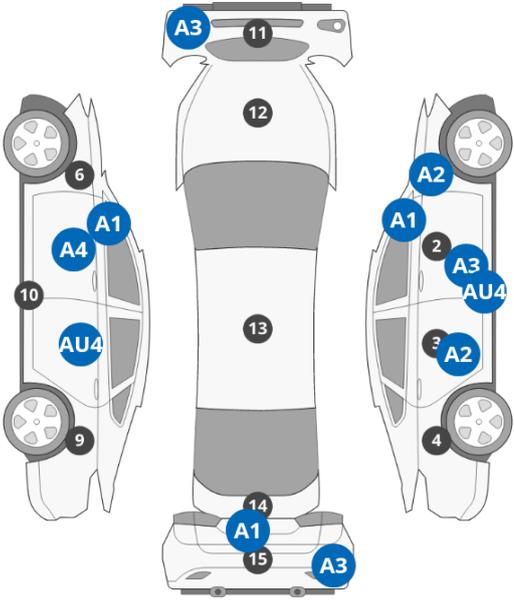
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.0	109	103	112
2	Boot Lid	104.3	100	104	109
3	Roof	95.1	96	91	95/99
4	Left Front Fender	101.0	102	100	101
5	Left Front Door	97.8	98	96	100
6	Center Panel Left				
7	Left Rear Door	99.9	100	98	102
8	Left Back Panel	104.9	108	107	100
9	Right Front Fender	101.7	101	105	99
10	Right Front Door	101.3	100	102	102
11	Center Panel Right				
12	Right Rear Door	95.8	94	95	99
13	Right Back Panel	107.0	102	107	112

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Minimal / (R) Front Seat - Grime - Medium / (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Missing - Yes / Rear Seat - Grime - Medium / (L) Front Seat - Grime - Small / Console, Switches, Vents - Traces of Adhesive Tape - Yes</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch - Large / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Mirror - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>without warranty booklet. With Spare tire, jack and incomplete tools. Without LTO plate.</p>