

## General Information

Date & Time: 11, Mar, 2025 15:25

<b>Make</b>	Toyota	<b>Model</b>	Veloz
<b>YOM</b>	2024	<b>Mileage</b>	10,217
<b>Registration No.</b>	NHS3986	<b>Chassis No.</b>	MHFAB1BY6R3101311
<b>CC</b>	1.5	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	SUV
<b>Colour</b>	Red Mica Metallic		

## Body / Panel Condition



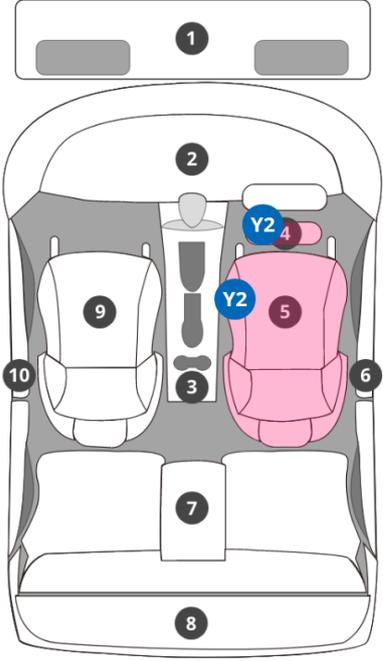
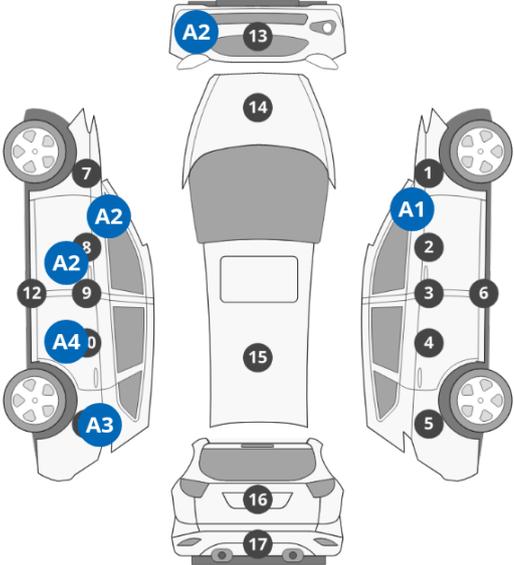
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.2	106	94	113
2	Boot Lid	93.5	86	106	89
3	Roof	112.6	120	130	104/96
4	Left Front Fender	95.7	96	89	102
5	Left Front Door	114.0	111	112	119
6	Center Panel Left				
7	Left Rear Door	105.0	112	102	101
8	Left Back Panel	115.3	124	113	109
9	Right Front Fender	95.7	98	98	92
10	Right Front Door	110.3	117	110	104
11	Center Panel Right				
12	Right Rear Door	104.0	106	102	104
13	Right Back Panel	113.0	107	104	128

Overall Evaluation :

**B**

### Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Seat - Grime - Small / (L) Front Floor Mat - Grime - Small</p>	<p><b>Remarks</b> (R) Mirror - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Large / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Warning Lamps - Issue - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>oil maintenance warning lamp. without warranty booklet and tools. with spare tire and jack. with LTO plate.</p>