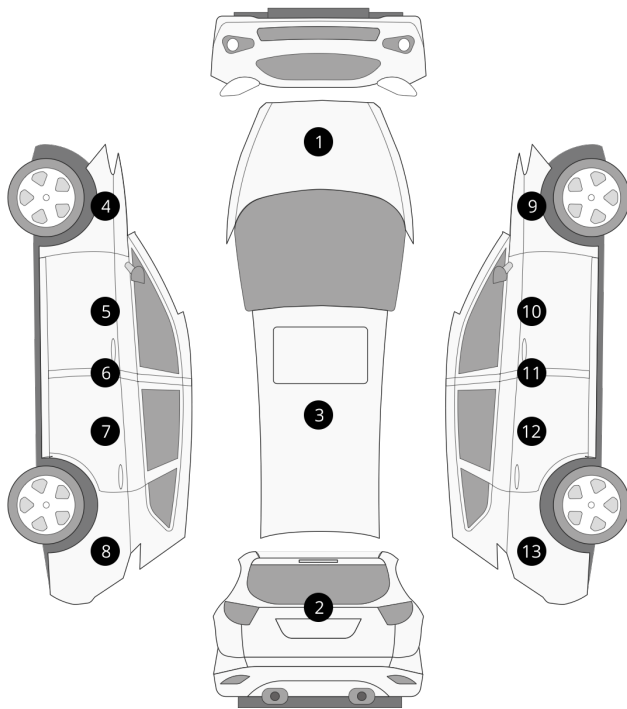


General Information

Date & Time: 22, Apr, 2025 16:51

Make	Toyota	Model	Vios
YOM	2021	Mileage	36,370
Registration No.	NEV2502	Chassis No.	PA1B18F39M4152979
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



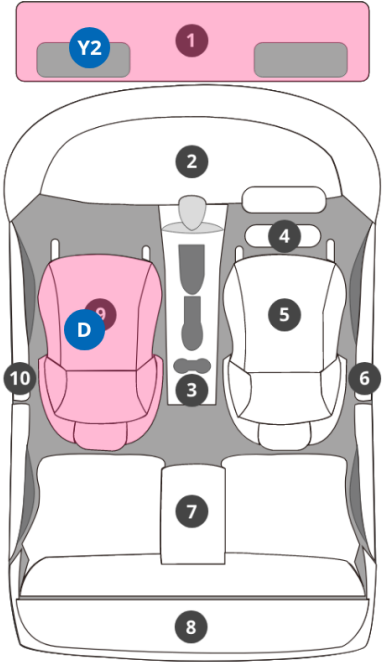
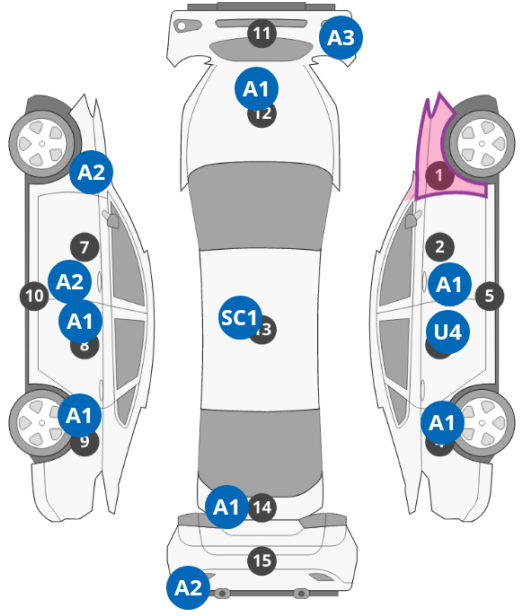
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	149.3	156	127	165
2	Boot Lid	94.4	89	97	98
3	Roof	89.1	100	84	84/89
4	Left Front Fender	82.8	85	82	81
5	Left Front Door	88.7	85	90	92
6	Center Panel Left				
7	Left Rear Door	132.0	130	127	139
8	Left Back Panel	160.0	159	177	144
9	Right Front Fender	143.0	124	152	153
10	Right Front Door	86.7	87	85	89
11	Center Panel Right				
12	Right Rear Door	136.0	150	141	117
13	Right Back Panel	150.6	131	135	186

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Worn - Yes / Ceiling - Grime - Small / Overall Interior - Worn as per age - Yes	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Roof - Rust, Corrosion - Minimal / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

With LTO plate, no warranty booklet, no jack, no tools, no spare tire