

General Information

Date & Time: 23, Apr, 2025 16:44

Make	Toyota	Model	Vios
YOM	2024	Mileage	16,618
Registration No.	NKA1904	Chassis No.	PA1B18F31R4242697
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



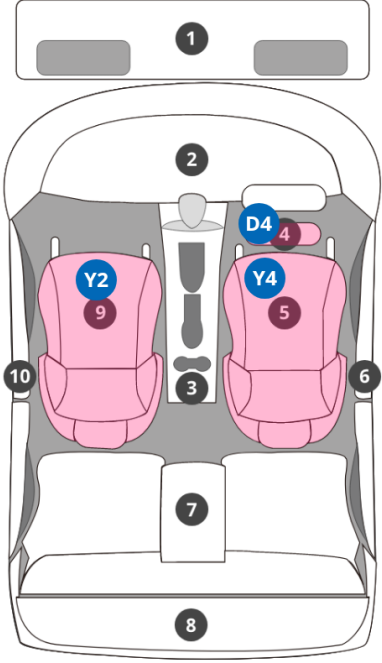
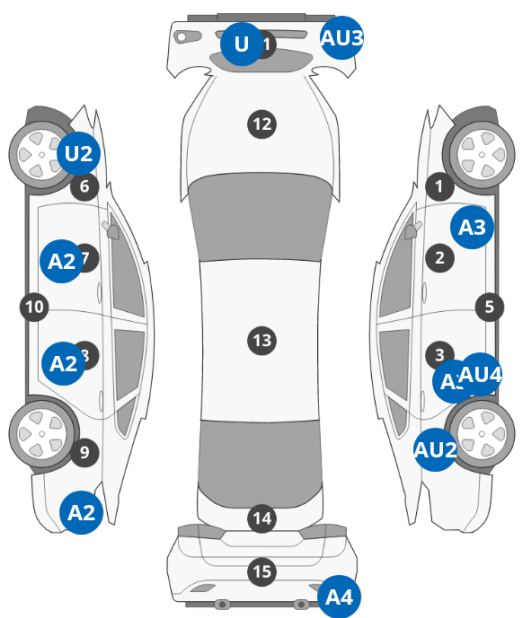
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	105.2	107	100	109
2	Boot Lid	94.8	94	93	98
3	Roof	98.6	95	100	94/106
4	Left Front Fender	89.0	88	87	92
5	Left Front Door	98.2	97	98	100
6	Center Panel Left				
7	Left Rear Door	98.6	102	99	94
8	Left Back Panel	99.5	103	100	96
9	Right Front Fender	90.1	86	92	92
10	Right Front Door	96.0	100	96	92
11	Center Panel Right				
12	Right Rear Door	92.8	89	93	97
13	Right Back Panel	102.0	99	99	108

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Grime - Small / (L) Front Floor Mat - Worked - Large / (R) Front Seat - Grime - Large	Remarks Rear Bumper, Lamps, Panels - Scratch - Large / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Front Door, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Member (Bolted) - Dent - Yes / (L) Front Fender, Molding - Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes

with warranty booklet/ with spare tire nd jack/ n tools/ with LTO plate