

General Information

Date & Time: 17, Mar, 2025 11:04

Make	Toyota	Model	Vios
YOM	2024	Mileage	6,706
Registration No.	DBM5373	Chassis No.	PA1B18F39R4245573
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



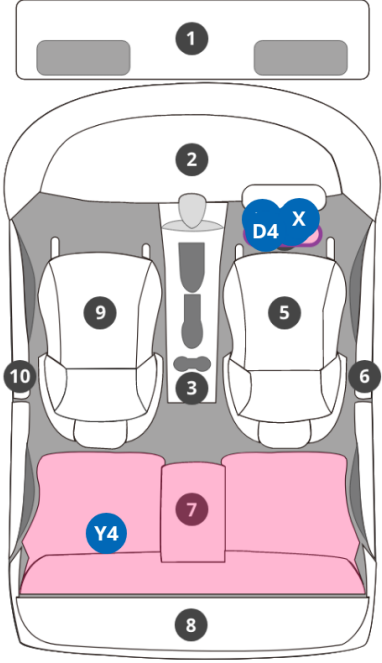
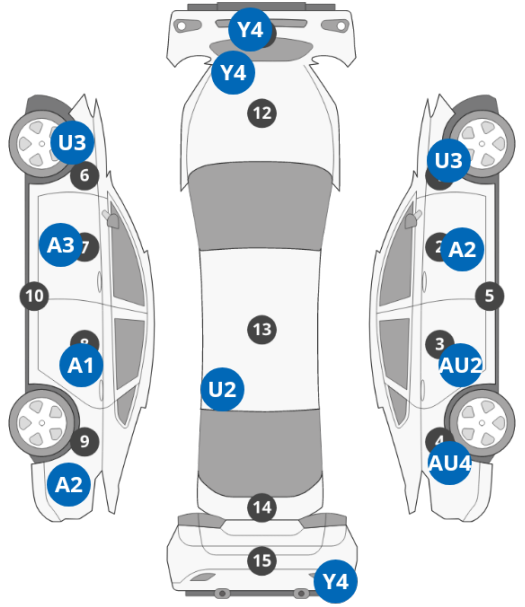
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.6	120	104	111
2	Boot Lid	98.3	94	99	102
3	Roof	100.9	105	104	95/100
4	Left Front Fender	94.6	95	95	95
5	Left Front Door	97.9	102	97	95
6	Center Panel Left				
7	Left Rear Door	101.0	108	105	90
8	Left Back Panel	105.0	107	105	103
9	Right Front Fender	97.9	103	96	95
10	Right Front Door	100.1	100	99	102
11	Center Panel Right				
12	Right Rear Door	109.6	103	107	119
13	Right Back Panel	110.6	121	105	106

Overall Evaluation :

D

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Large / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Carpet - Worked - Large	Remarks Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Crack, Gap - Large / (R) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Crack, Gap - Large / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Dent - Medium / (L) Front Door, Molding - Scratch - Medium / Roof - Dent - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Dent - Medium
Frame Evaluation : C	Functional Evaluation : D
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Warning Lamps - Issue - Yes / Power Steering - Issue - Yes / Battery - Weak - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes

Inspector Notes
with warranty booklet/ with spare tire and jack/ no LTO plate/ no tools/ warning lamp(check engine and power steering issue/ head lights issue (mis aligned) / tail light issue (cracked)