

General Information

Date & Time: 30, Jun, 2026 14:49

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	46,043
Registration No.	NIM4094	Chassis No.	PA1B18F31P4207381
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



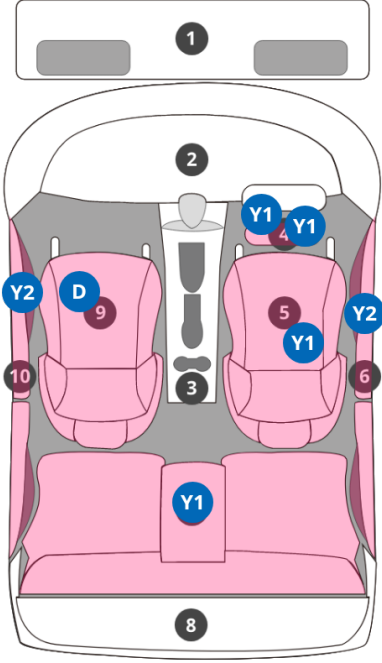
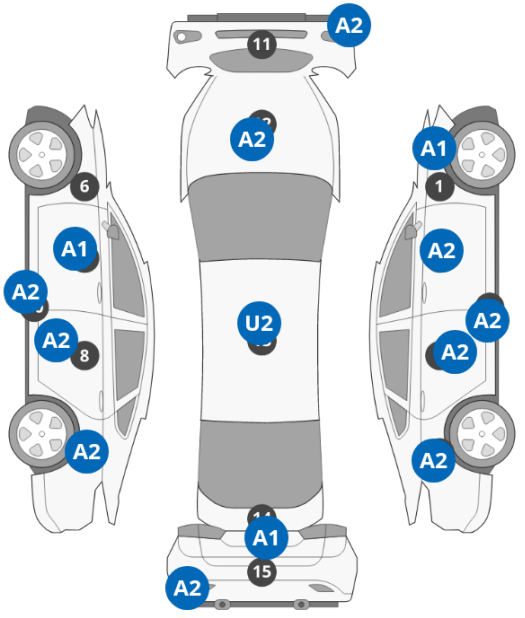
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.3	108	112	102
2	Boot Lid	109.3	111	101	116
3	Roof	96.1	97	93	95/99
4	Left Front Fender	103.0	101	106	102
5	Left Front Door	121.6	123	118	124
6	Center Panel Left				
7	Left Rear Door	101.9	106	99	101
8	Left Back Panel	116.6	127	111	112
9	Right Front Fender	102.2	100	97	110
10	Right Front Door	103.3	102	103	105
11	Center Panel Right				
12	Right Rear Door	105.5	99	105	113
13	Right Back Panel	109.3	112	100	116

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Minimal / (L) Front Floor Mat - Grime - Minimal / (R) Front Seat - Grime - Minimal / (L) Front Seat - Worn - Yes / Rear Seat - Grime - Minimal / Overall Interior - Worn as per age - Yes	Remarks Bonnet, Headlight - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Roof - Dent - Small
Frame Evaluation : A	Functional Evaluation : E
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Panel, Meter - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Door Lock - Issue - Yes / Sun Roof - Stuck, Gap - Yes / Power Seat - Issue - Yes / Power Steering - Issue - Yes / Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Power Steering Pump - Leak - Yes / Radiator Water Pump - Leak - Yes / Battery - Weak - Yes / Remote Key & Smart entry - Issue - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Parking Brake - Function - Weak / Brake Pedal - Function - Weak / Turn Signal, Hazard Flasher - Issue - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Horn - Issue - Yes / Seat Belts - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
non moving vehicle/with ORCR/mileage and functional cannot be determined due to non moving unit/no tools and jack/with spare tire