

General Information

Date & Time: 14, Mar, 2025 16:27

Make	Mazda	Model	Mazda 2
YOM	2016	Mileage	82,602
Registration No.	ABE8401	Chassis No.	MM7DJ2HAAGW161394
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Black		

Body / Panel Condition



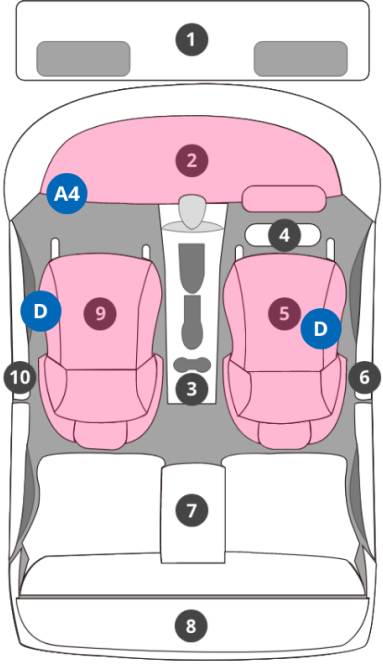
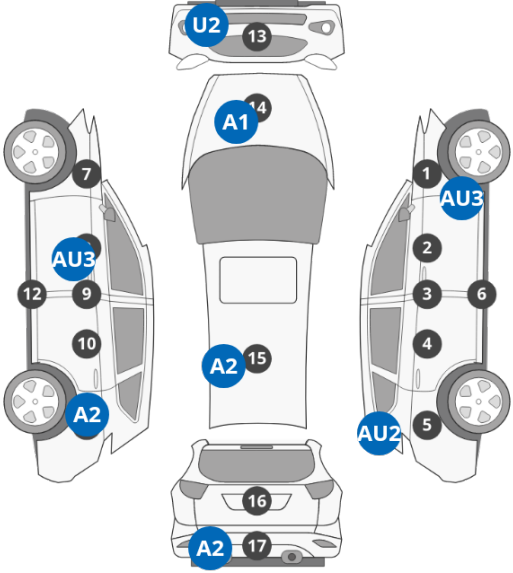
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	105.0	124	96	95
2	Boot Lid	128.6	125	131	130
3	Roof	110.6	105	88	145/104
4	Left Front Fender	102.8	92	108	109
5	Left Front Door	101.5	103	103	99
6	Center Panel Left				
7	Left Rear Door	101.6	105	100	100
8	Left Back Panel	98.6	106	98	92
9	Right Front Fender	101.7	103	104	98
10	Right Front Door	126.0	133	138	107
11	Center Panel Right				
12	Right Rear Door	129.6	130	120	139
13	Right Back Panel	136.0	111	151	146

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Worn - Yes / Steering Wheel - Worn, Peel, Crack - Large / (R) Front Seat - Worn - Yes</p>	<p>Remarks (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / Roof - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Dent - Small / Bonnet, Headlight - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Retractable Mirror - Issue - Yes / Remote Key & Smart entry - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklt/ with LTO plate jack and tools and spare tire/ retractable mirror issue/ low battery key</p>