

General Information

Date & Time: 20, Mar, 2025 12:02

Make	Toyota	Model	Vios
YOM	2024	Mileage	14,750
Registration No.	NHR9841	Chassis No.	PA1B18F37P4234939
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



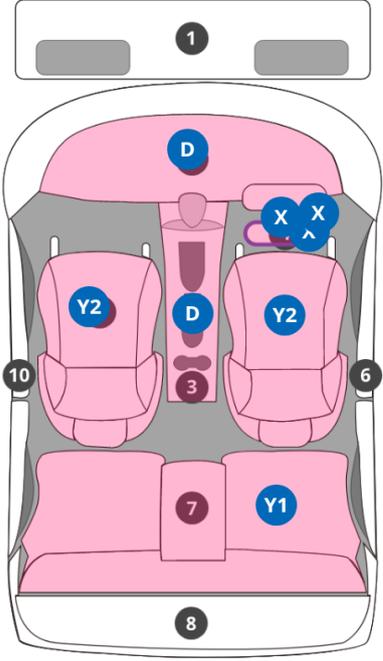
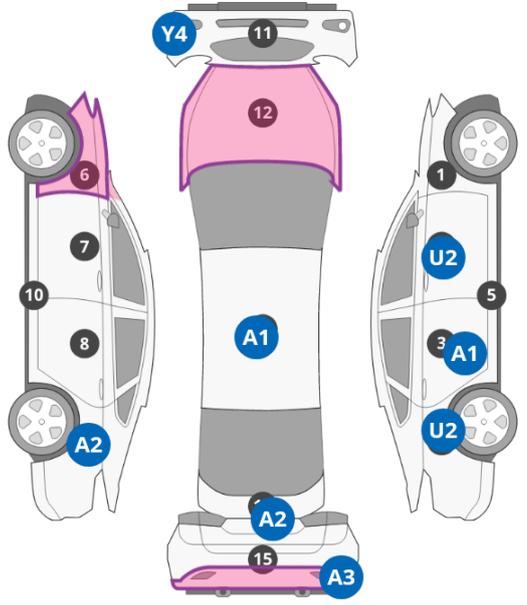
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	127.3	114	158	110
2	Boot Lid	110.0	107	105	118
3	Roof	100.5	103	103	93/103
4	Left Front Fender	508.0	600	781	143
5	Left Front Door	99.1	96	100	102
6	Center Panel Left				
7	Left Rear Door	103.5	102	99	110
8	Left Back Panel	123.0	115	112	142
9	Right Front Fender	90.8	91	86	95
10	Right Front Door	96.1	98	93	97
11	Center Panel Right				
12	Right Rear Door	101.0	100	102	101
13	Right Back Panel	99.6	101	96	102

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Dashboard - Traces of Adhesive Tape - Yes / Console, Switches, Vents - Traces of Adhesive Tape - Yes / Rear Seat - Grime - Minimal / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small</p>	<p>Remarks (L) Front Fender - Repair Traces - Yes / Front Bumper, Grille, Lamps - Crack, Gap - Large / (L) Front Fender, Molding - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Dent - Small / Trunk Hood, Rear Gate - Scratch - Small / Bonnet, Headlight - Repair mark - Difference in Color / (R) Rear Door, Molding - Scratch - Minimal / (R) Front Door, Molding - Dent - Small / Roof - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Repair mark - Difference in Color</p>
Frame Evaluation : A	Functional Evaluation : C
<p>Remarks Defects not found</p>	<p>Remarks Power Steering - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>WITH LTO PLATE AND WARRANTY BOOKLET. WITH JACK AND SPARE TIRE. NO TOOLS , ADHESIVE MARKS ON ALL DOORS</p>