

General Information

Date & Time: 19, Mar, 2025 15:33

Make	Jeep	Model	Cherokee
YOM	2015	Mileage	61,682
Registration No.	ABF2556	Chassis No.	1C4PJMDB0FW582881
CC	2.4	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	Blue		

Body / Panel Condition



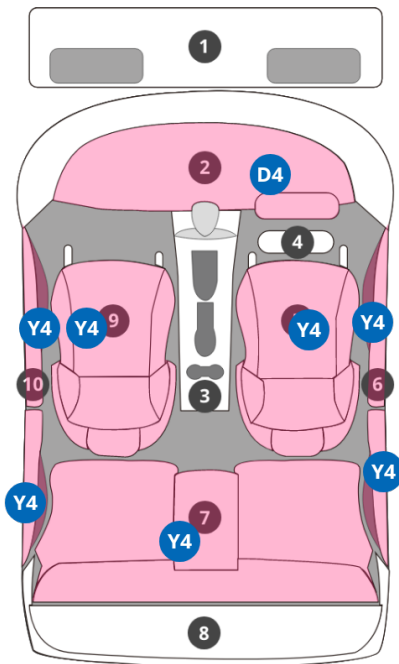
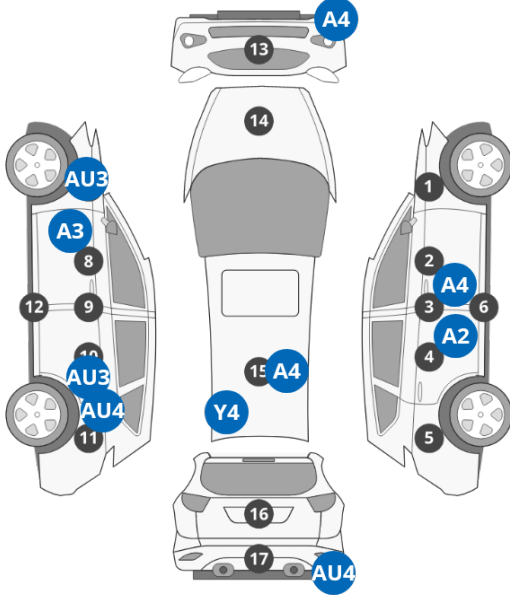
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	222.3	216	250	201
2	Boot Lid	201.0	192	201	210
3	Roof	210.0	179	181	219/261
4	Left Front Fender	190.6	165	185	222
5	Left Front Door	224.3	226	227	220
6	Center Panel Left				
7	Left Rear Door	201.3	216	210	178
8	Left Back Panel	187.3	177	181	204
9	Right Front Fender	217.6	246	211	196
10	Right Front Door	219.0	214	219	224
11	Center Panel Right				
12	Right Rear Door	216.3	230	212	207
13	Right Back Panel	220.0	240	216	204

Overall Evaluation :

D

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Rear Trim - Grime - Large / Rear Seat - Grime - Large / (L) Front Trim - Grime - Large / (L) Front Seat - Grime - Large / (R) Front Seat - Grime - Large / Dashboard - Worked - Large / (R) Front Trim - Grime - Large / (R) Rear Trim - Grime - Large</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (L) Front Fender, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Windshield - Damaged - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Large / Front Bumper, Grille, Lamps - Scratch - Large / Roof - Scratch - Large</p>
Frame Evaluation : A	Functional Evaluation : D
<p>Remarks Defects not found</p>	<p>Remarks Panel, Meter - Issue - Yes / Power Seat - Issue - Yes / Battery - Weak - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>headlight issue/ fog light issue/ passenger seat not moving/ tail light issue/ trunk door not opening/possible flooding/ no spare tire/ no warranty booklet/ need to inflate tires/ foggy instrument panel/ no tools and jack / with LTO plate/ non moving due to weak battery/ door issue/</p>