

General Information

Date & Time: 28, Mar, 2025 08:13

Make	Toyota	Model	Vios
YOM	2024	Mileage	8,176
Registration No.	NHM3747	Chassis No.	PA1B18F34R4238871
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



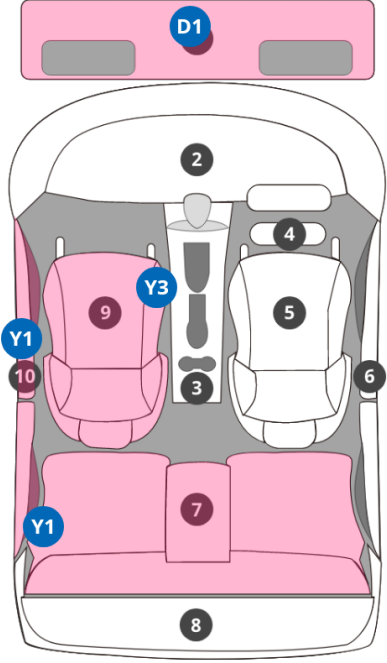
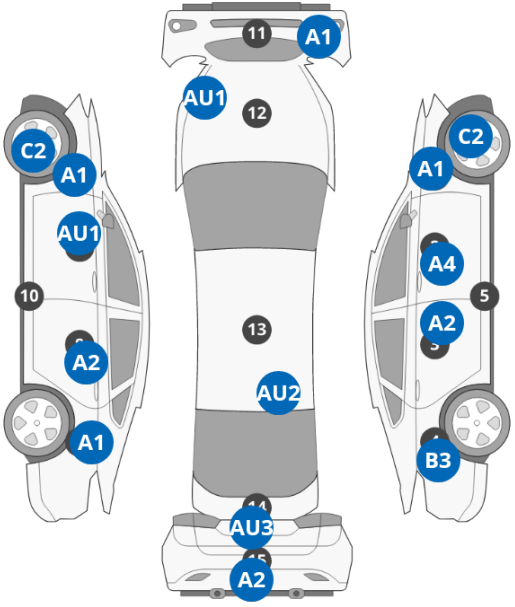
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.5	120	99	113
2	Boot Lid	97.9	105	89	100
3	Roof	93.0	96	94	88/94
4	Left Front Fender	88.5	91	84	90
5	Left Front Door	95.1	93	95	98
6	Center Panel Left				
7	Left Rear Door	100.1	105	96	100
8	Left Back Panel	103.2	109	106	95
9	Right Front Fender	95.8	98	92	98
10	Right Front Door	98.0	96	95	103
11	Center Panel Right				
12	Right Rear Door	95.6	95	93	98
13	Right Back Panel	106.0	101	102	115

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Crinkle - Minimal / Rear Seat - Grime - Minimal / (L) Front Seat - Grime - Medium / (L) Front Trim - Grime - Minimal	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Wheel, Cover - Scratch, Corrosion - Small / (R) Front Door, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Modified - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / Roof - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Front Wheel, Cover - Scratch, Corrosion - Small / Front Bumper, Grille, Lamps - Scratch - Minimal / Bonnet, Headlight - Scratch & Dent - Minimal / (L) Front Fender, Molding - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
No LTO plate/with warranty booklet/with jack and tools/with spare tire/paint and stain on rear bumper and trunk and left rear door