

General Information

Date & Time: 26, Mar, 2025 15:44

Make	Toyota	Model	Vios
YOM	2024	Mileage	7,883
Registration No.	EAG6841	Chassis No.	PA1B18F38P4236814
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	White		

Body / Panel Condition



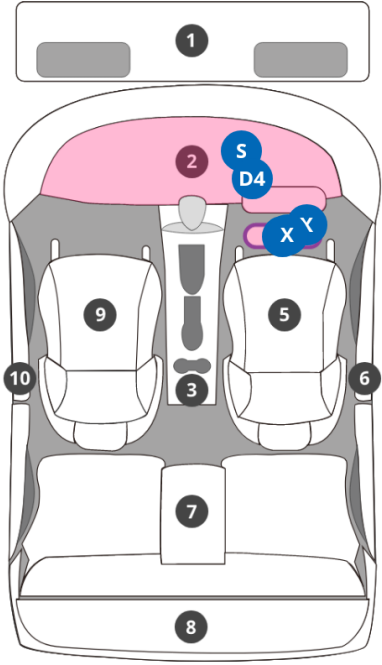
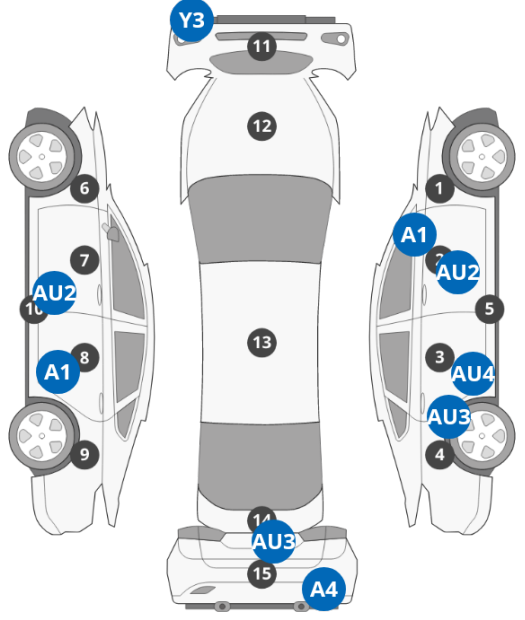
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	119.3	123	107	128
2	Boot Lid	133.0	129	138	132
3	Roof	106.5	101	108	107/110
4	Left Front Fender	104.6	110	101	103
5	Left Front Door	99.8	101	100	99
6	Center Panel Left				
7	Left Rear Door	100.2	103	99	98
8	Left Back Panel	112.6	115	114	109
9	Right Front Fender	115.0	114	112	119
10	Right Front Door	110.6	107	114	111
11	Center Panel Right				
12	Right Rear Door	111.6	110	112	113
13	Right Back Panel	110.6	103	112	117

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Smell - Yes / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Glove Box - Loose, Deformed - Large	Remarks (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Large / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Small / (R) Mirror - Scratch, Peeled - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Medium
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes

Inspector Notes
glovebox cannot be closed/ no warranty booklet/ possible flooding / no tools and jack / with LTO plate and spare tire/ scratch at tail light