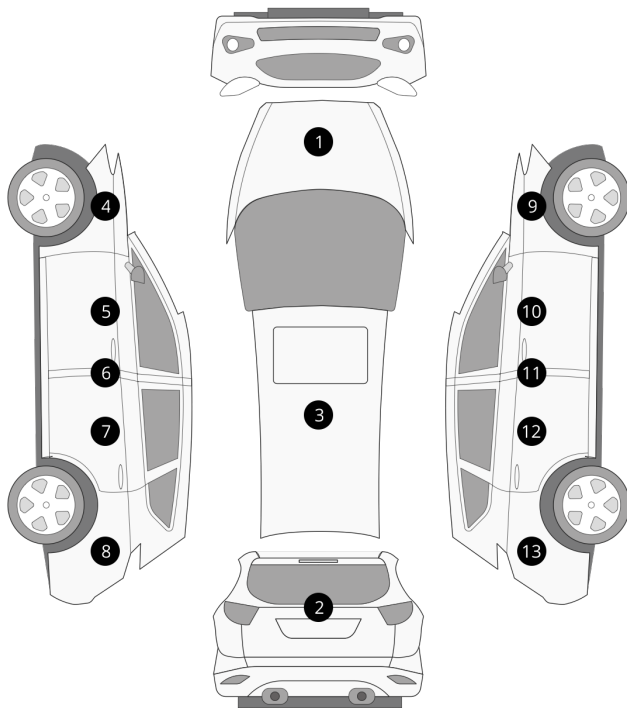


General Information

Date & Time: 26, Mar, 2025 10:55

Make	Toyota	Model	Vios
YOM	2024	Mileage	23,588
Registration No.	GBE2394	Chassis No.	PA1B18F30R4248121
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



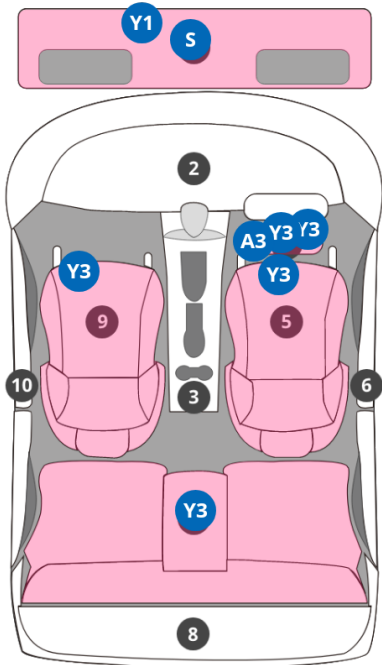
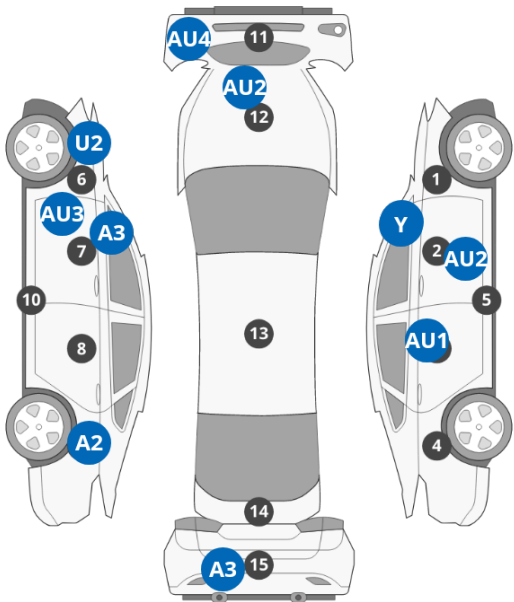
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.6	115	112	111
2	Boot Lid	108.3	106	108	111
3	Roof	100.7	104	96	100/103
4	Left Front Fender	96.1	102	96	91
5	Left Front Door	96.0	97	96	95
6	Center Panel Left				
7	Left Rear Door	97.4	95	101	97
8	Left Back Panel	102.8	111	98	100
9	Right Front Fender	102.1	103	106	97
10	Right Front Door	100.0	97	102	101
11	Center Panel Right				
12	Right Rear Door	97.7	97	97	100
13	Right Back Panel	107.3	101	94	127

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Medium / (R) Front Floor Mat - Grime - Medium / Rear Seat - Grime - Medium / Mat Other - Grime - Medium / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Cut, Crack - Medium / Overall Interior - Smell - Yes / Ceiling - Grime - Minimal	Remarks (R) Rear Door, Molding - Scratch & Dent - Minimal / Bonnet, Headlight - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Mirror - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (L) Front Fender, Molding - Dent - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / (R) Mirror - Crack - Damaged
Frame Evaluation : A Remarks Defects not found	Functional Evaluation : B Remarks Retractable Mirror - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

Possible flooding. without warranty booklet. With Spare tire, jack and incomplete tools. Without LTO plate.