

General Information

Date & Time: 31, Mar, 2025 17:22

Make	Toyota	Model	Vios
YOM	2024	Mileage	6,160
Registration No.	NHM9745	Chassis No.	PA1B18F30R4241489
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



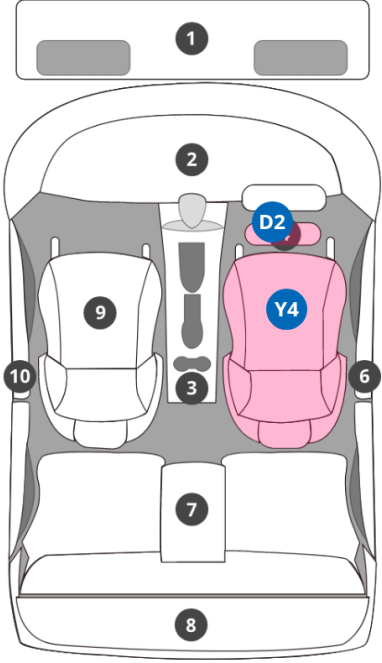
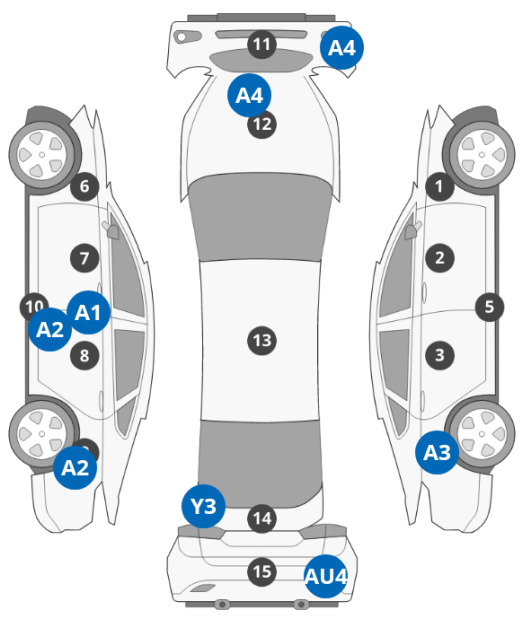
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.6	105	103	103
2	Boot Lid	102.7	98	106	104
3	Roof	90.9	94	88	87/95
4	Left Front Fender	92.4	97	94	86
5	Left Front Door	104.0	102	106	104
6	Center Panel Left				
7	Left Rear Door	100.3	105	97	99
8	Left Back Panel	104.4	114	102	97
9	Right Front Fender	93.9	92	92	98
10	Right Front Door	97.5	100	101	92
11	Center Panel Right				
12	Right Rear Door	94.7	93	96	96
13	Right Back Panel	99.8	92	100	108

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Large / (L) Front Floor Mat - Worked - Small	Remarks Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Large / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Crack, Gap - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet and spare tire/ with LTO plate/ no jack and tools/ broken tail light and rear reflector/