

General Information

Date & Time: 02, Jul, 2025 10:48

Make	Toyota	Model	Raize
YOM	2022	Odo Meter Reading	65,940
Registration No.	DAQ9414	Chassis No.	MHKAB1BA2NJ016718
CC	1.2	Transmission	CVT
Fuel Type	Gas	Type of Body	SUV
Colour	Silver		

Body / Panel Condition



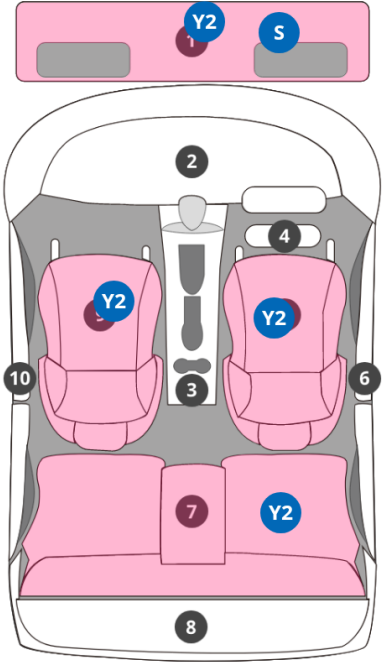
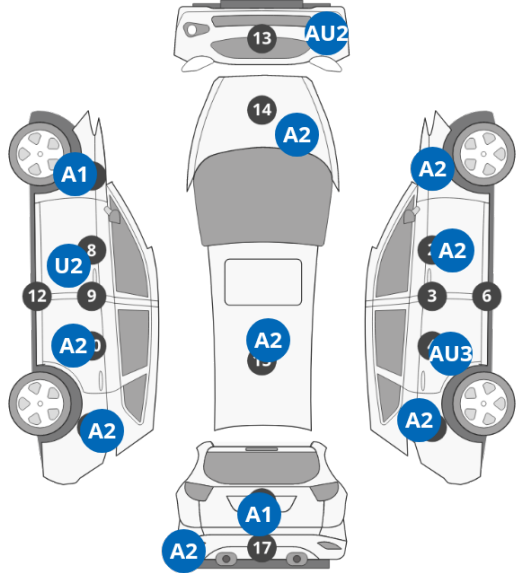
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	161.6	162	162	161
2	Boot Lid	91.9	87	100	89
3	Roof	131.0	119	210	96/99
4	Left Front Fender	184.6	187	163	204
5	Left Front Door	149.6	140	150	159
6	Center Panel Left				
7	Left Rear Door	136.3	157	133	119
8	Left Back Panel	94.0	93	94	95
9	Right Front Fender	149.3	148	149	151
10	Right Front Door	142.0	141	143	142
11	Center Panel Right				
12	Right Rear Door	146.0	121	163	154
13	Right Back Panel	90.3	90	91	91

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Worn as per age - Yes / Overall Interior - Smell - Yes / Rear Seat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small / Ceiling - Grime - Small	Remarks (L) Front Fender - Repair Traces - Yes / Roof - Repair Traces - Yes / (L) Front Door, Molding - Dent - Small / (L) Rear Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / Roof - Scratch - Small / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Small
Frame Evaluation : B	Functional Evaluation : E
Remarks Front Cross Member Support - Condition of Welding ? - Yes	Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Panel, Meter - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Door Lock - Issue - Yes / Sun Roof - Stuck, Gap - Yes / Power Seat - Issue - Yes / Power Steering - Issue - Yes / Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Power Steering Pump - Leak - Yes / Radiator Water Pump - Leak - Yes / Battery - Weak - Yes / Remote Key & Smart entry - Issue - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Parking Brake - Function - Weak / Brake Pedal - Function - Weak / Turn Signal, Hazard Flasher - Issue - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Horn - Issue - Yes / Seat Belts - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

with jack and Spare tire. no warranty booklet and LTO plate and no tools. back door did not open, quarter glass broken. unit functional can't operate due to vehicle is not moving. key slot issue.