


General Information

Date & Time: 01, Apr, 2025 15:22

Make	Toyota	Model	Vios
YOM	2024	Mileage	38,417
Registration No.	DBN9706	Chassis No.	PA1B18F38P4236473
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	White		

Body / Panel Condition

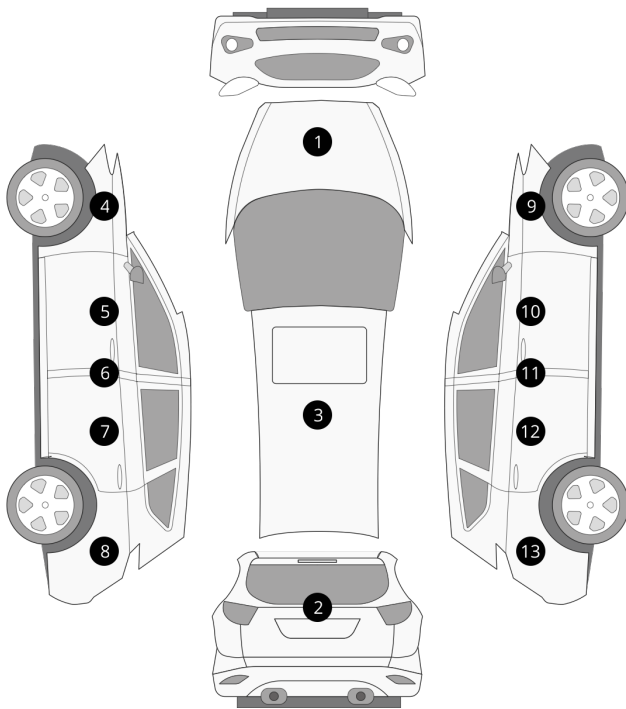

#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	121.6	122	117	126
2	Boot Lid	124.0	128	120	124
3	Roof	105.0	113	103	102/102
4	Left Front Fender	106.3	105	105	109
5	Left Front Door	99.0	99	98	100
6	Center Panel Left				
7	Left Rear Door	98.5	101	99	96
8	Left Back Panel	108.0	111	108	105
9	Right Front Fender	117.6	117	122	114
10	Right Front Door	115.6	115	117	115
11	Center Panel Right				
12	Right Rear Door	113.6	110	112	119
13	Right Back Panel	109.0	100	116	111

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : C
a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain Remarks Overall Interior - Animal Hair - Yes / Overall Interior - Smell - Yes / (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Small / Ceiling - Grime - Small	A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap Remarks (R) Front Fender, Molding - Dent - Medium / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Roof - Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

no warranty booklet, with jack, incomplete tools, with spare tire, NO LTO plate, aftermarket floormat worked