

General Information

Date & Time: 01, Apr, 2025 10:08

Make	Toyota	Model	Vios
YOM	2024	Mileage	14,137
Registration No.	NKI9442	Chassis No.	PA1B18F39R4260185
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



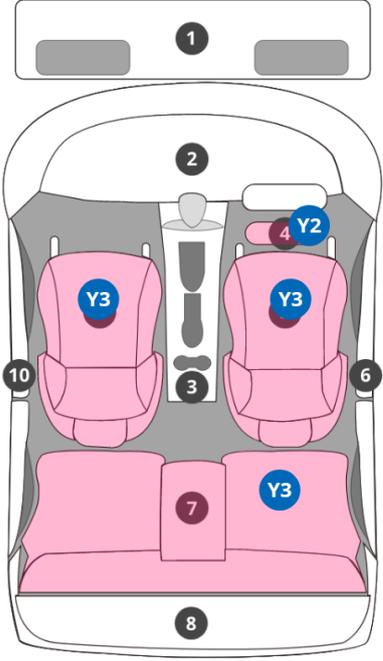
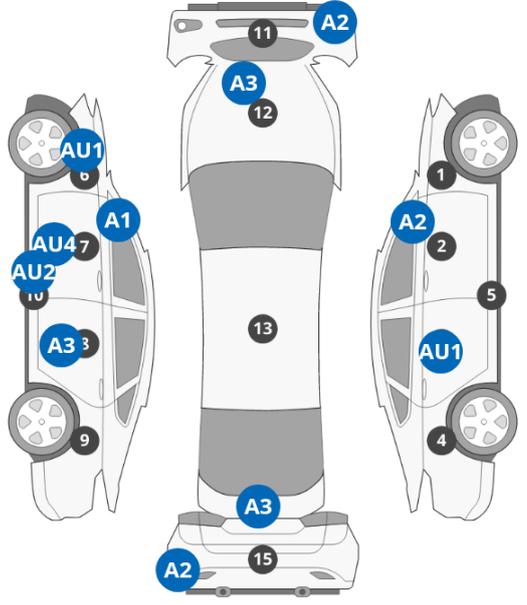
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.6	106	103	105
2	Boot Lid	96.2	92	96	101
3	Roof	95.9	103	94	87/100
4	Left Front Fender	96.8	98	96	96
5	Left Front Door	98.7	101	100	95
6	Center Panel Left				
7	Left Rear Door	100.9	105	100	98
8	Left Back Panel	94.9	100	91	94
9	Right Front Fender	95.3	93	99	94
10	Right Front Door	90.3	93	88	90
11	Center Panel Right				
12	Right Rear Door	94.0	96	94	93
13	Right Back Panel	96.6	93	95	102

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / (R) Front Floor Mat - Grime - Small / Rear Seat - Grime - Medium / (L) Front Seat - Grime - Medium</p>	<p>Remarks (L) Front Fender, Molding - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Medium / (R) Mirror - Scratch - Small / Bonnet, Headlight - Scratch - Medium / (L) Rear Door, Molding - Scratch - Medium / (L) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small</p>
Frame Evaluation : D	Functional Evaluation : A
<p>Remarks Left Center Pillar - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With warranty booklet and spare tire. Without tools and jack. With LTO plate.</p>