

General Information

Date & Time: 31, Mar, 2025 12:31

Make	Toyota	Model	Veloz
YOM	2024	Mileage	6,651
Registration No.	DBP4289	Chassis No.	MHFAB1BY8R3102220
CC	1.5	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Silver		

Body / Panel Condition



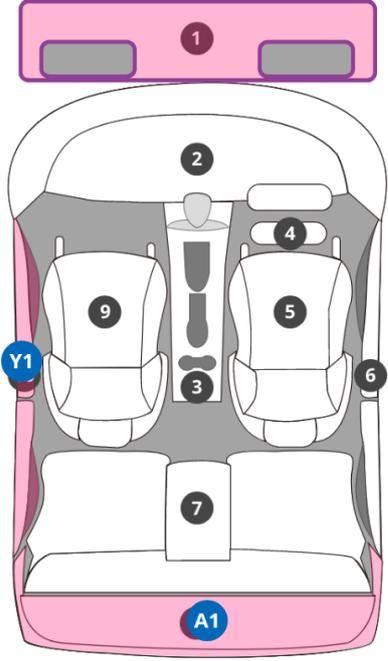
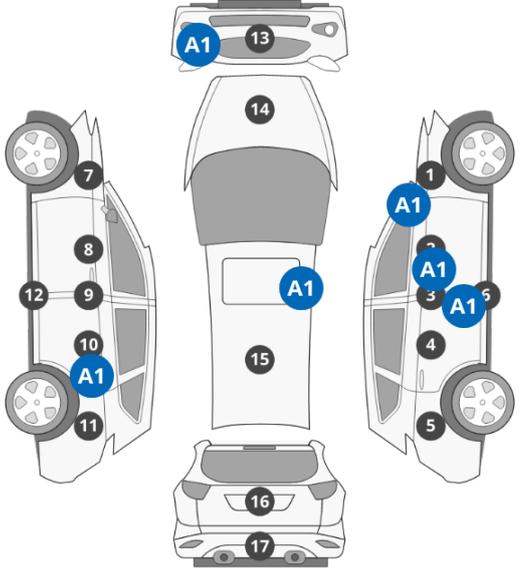
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	98.9	96	92	109
2	Boot Lid	101.6	83	99	123
3	Roof	106.6	112	120	99/96
4	Left Front Fender	99.4	99	95	104
5	Left Front Door	117.6	102	136	115
6	Center Panel Left				
7	Left Rear Door	110.0	102	103	125
8	Left Back Panel	112.1	127	79	130
9	Right Front Fender	95.7	94	102	91
10	Right Front Door	105.6	107	107	103
11	Center Panel Right				
12	Right Rear Door	113.3	126	105	109
13	Right Back Panel	125.3	116	131	129

Overall Evaluation :

A

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : A
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Trim - Grime - Minimal / Trunk Room - Worn, Scratch, Cut, Crack - Minimal / Room Lamp - Partially Missing - Yes</p>	<p>Remarks (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / Roof - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/no warranty booklet/with spare tire/with jack/no tools/rear dome light issue</p>