

General Information

Date & Time: 28, Mar, 2025 09:36

Make	Toyota	Model	Vios
YOM	2024	Mileage	20,827
Registration No.	DBO8137	Chassis No.	PA1B18F35R4254531
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



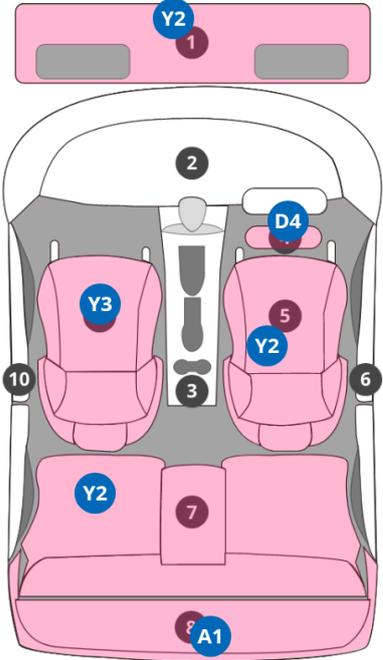
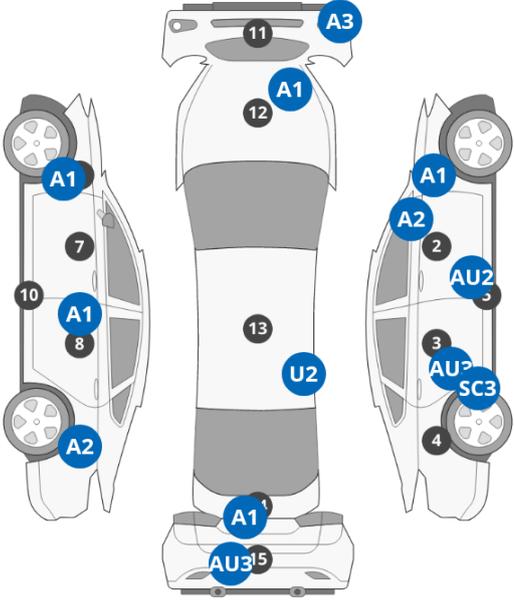
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.6	124	101	119
2	Boot Lid	103.7	99	102	110
3	Roof	94.1	98	93	92/94
4	Left Front Fender	101.2	95	91	117
5	Left Front Door	98.3	103	92	100
6	Center Panel Left				
7	Left Rear Door	113.0	97	146	97
8	Left Back Panel	102.8	112	97	100
9	Right Front Fender	99.6	90	119	90
10	Right Front Door	96.2	97	92	100
11	Center Panel Right				
12	Right Rear Door	97.0	102	96	93
13	Right Back Panel	106.7	87	104	129

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Small / Ceiling - Grime - Small / Rear Seat - Grime - Small / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Worked - Large / Trunk Room - Worn, Scratch, Cut, Crack - Minimal</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Rust, Corrosion - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Roof Spoiler, Molding - Dent - Small / Bonnet, Headlight - Scratch - Minimal / (R) Mirror - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With LTO plate/with warranty booklet/with tools and jack/with spare tire</p>